



Your trusted partner for buying, selling, and managing property,
ensuring hassle-free service with 100% transparency.

3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai, India

hello@verified.realestate

+91 9996 12 9996

Official Property Record

Digitally Verified Record - Powered by Verified  RealEstate™





821 (Old No. 439/4) Poonamallee High Road, Arumbakkam, Chennai 600 106.

Phone: 044 - 2363 7146; e-mail: paygec@yahoo.com

CIN: U74210TN1992PTC023645

GEOTECHNICAL SITE INVESTIGATION

BORING 1 THROUGH 27

PROPOSED RESIDENTIAL APARTMENTS AND VILLA BUILDINGS SITE

**S NO 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2,
176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203,
204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208,
209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4**

VENGAIVASAL VILLAGE, TAMBARAM TALUK

KANCHEEPURAM DISTRICT, TN.

**For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.**

**Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director**

Report to

**M/s. Emerald Haven Realty Ltd.
1st Floor Greenways Towers
No. 119, St. Mary's Road
Abhiramapuram, Chennai 600 018, TN.**



821 (Old No. 439/4) Poonamallee High Road, Arumbakkam, Chennai 600 106.

Phone: 044 - 2363 7146; e-mail: paygec@yahoo.com

CIN: U74210TN1992PTC023645

Report No. 204/GI/18-19.
December 10, 2018.

M/s. Emerald Haven Realty Ltd.
1st Floor Greenways Towers
No. 119, St. Mary's Road
Abhiramapuram, Chennai 600 018, TN.

Corrected Report Incorporating Missing
S. No. as per client's e-mail.

Date: 20-09-2024.

Geotechnical Site Investigation
Boring 1 through 27

Proposed Residential Apartment and Villa Buildings Site

S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4
Vengaivasal Village, Tambaram Taluk
Kancheepuram District, TN.

The Prasad Armstrong Yen GEC (P) Ltd., Chennai is pleased to submit this report on our geotechnical site investigation conducted at the above location. This work was authorized by your Work Order No. WO/002/EHR/VGVL dated November 10, 2018.

Estimated capacities of the foundations recommended for the proposed buildings are presented here in final form together with a summary of laboratory and field data.

We appreciate the opportunity to be of service to you on this project. Please call us if you have any questions or when we can be of further assistance.

Sincerely,

PRASAD ARMSTRONG YEN GEC (P) Ltd.

B. Ram Prasad ME, PhD (Texas A&M)
Managing Director

(204brpt)
Copies Submitted: (3)

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

CONTENTS

	<u>Page</u>
SUMMARY	i
INTRODUCTION	1
Purpose and Scope	1
Report Format	1
FIELD AND LABORATORY INVESTIGATIONS	1
Exploratory Borings	1
Field and Laboratory Tests	2
GENERAL SOIL CONDITIONS	2
Topography	2
Soil Stratigraphy	2
Interpretation of Soil Properties	6
DESIGN INFORMATION	10
GROUNDWATER	11
CONSTRUCTION CONSIDERATIONS	11
REFERENCES	13

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.



Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

ILLUSTRATIONS

	<u>Plate</u>
Bore Hole Location Plan	1
Log of Boring 1	2
Log of Boring 2	3
Log of Boring 3	4
Log of Boring 4	5
Log of Boring 5	6
Log of Boring 6	7
Log of Boring 7	8
Log of Boring 8	9
Log of Boring 9	10
Log of Boring 10	11
Log of Boring 11	12
Log of Boring 12	13
Log of Boring 13	14
Log of Boring 14	15
Log of Boring 15	16
Log of Boring 16	17
Log of Boring 17	18
Log of Boring 18	19
Log of Boring 19	20
Log of Boring 20	21
Log of Boring 21	22
Log of Boring 22	23
Log of Boring 23	24
Log of Boring 24	25
Log of Boring 25	26
Log of Boring 26	27
Log of Boring 27	28
Summary of Test Results	29
Grain Size Distribution Curves	30
Summary of Water Test Results	31
Sample Calculations for Recommended Foundation	32
Liquefaction Analysis Results	33

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

B. Ramprasad

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

SUMMARY

Prasad Armstrong Yen GEC (P) Ltd. performed a geotechnical site investigation at the **Proposed Residential Apartment and Villa Buildings Site**, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram District, TN. The primary purpose of this investigation was to obtain data to develop foundation design recommendations for the proposed villa buildings and Stilt + 7 floors apartment buildings. This investigation was performed to identify variability in soil stratification of the site, and select suitable foundation, and estimate load carrying capacities of the considered foundation. For the proposed buildings typical maximum column load will be about 150 tons. These details were used only for estimating the preliminary foundation size and type of foundation.

The field investigation was performed November 28 through December 7, 2018. Number and location of borings were selected to cover the proposed buildings area as per the layout plan provided by the client. Boring 1 through 27 were drilled between 5- to 8-M penetration below the Existing Ground Level (EGL). Drilling of the borings was terminated after encountering hard stratum with SPT "N" ≥ 75 in at least three successive tests below the expected foundation level or on high core recovery at termination depth. NX TC bit and Diamond bit core barrels were used for drilling through the rocky formation. In most of the borings rock core pieces were recovered at bore termination depth. Tests were conducted to determine the pertinent index and engineering properties of the soils and rock encountered. We then performed engineering analyses to develop the required design data.

Natural topography of the site reflects a relatively flat terrain. Visual observation infers that EGL of the site was about 0.5- to 1.2-M below the Existing Road Level (ERL) of road near the site. A few trees and many bushes and shrubs were present in the site. Fencing stones, boundary stones were present along various parts of the site boundaries. Proposed construction will be the first major construction activity to cover this site. Soil stratigraphy at the borings is tabulated below.

Typical Site Soil Profile:

Stratum	Penetration, M		Description
	From	To	
I	0	1.0-2.0	Silty Fine to Coarse Sand / Stiff Clay
II	1.0-2.0	5.0-8.0+	Weathered Rock / Hard Granite

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

Data from borings indicate presence of weathered rock with high SPT "N" values from shallow depth. For the proposed villa and apartments buildings it was **recommended** to provide **Isolated Column Footing** foundation at 2-M below EGL with at least 1-M thick site filling above EGL. The footing should have at least 3-M of **embedment around the footings**. A minimum footing width of 1.5-M was considered in analysis. For the considered foundation the **estimated ultimate and recommended allowable capacities were 89 and 25 tons/M²**, respectively. Estimated total settlement was about 6 mm, less than 60 mm, the IS: 1904 - 2006 code limiting settlement for isolated column footings of framed structures with panel walls on granular soil. All the footings should be interconnected in both directions. It was also recommended to provide continuous lintels in each floor

for better resistance to seismic forces and differential settlements. In case of footings on or near the filled open wells or locations with loose soils at 2-M level then the loose soils upto lower level hard layer should be replaced with well compacted lean concrete. Also footings around these wells should be made into "Combined Footings" with a maximum bearing pressure limited to 15 tons/M². Pile foundation for these filled up open well areas was not recommended as the installation of piles into these hard rocky formation will be very difficult.

Groundwater was present in the borings at highly variable depths from 1-M below EGL to completely dry borings. This is very likely due to recent rains and presence of rocky formation at variable depth in the site. An 8.25-M diameter and unknown depth open well was present in the site at about 27.7-M from Boring 7 with groundwater at 2.1-M below EGL. Groundwater sample was collected from this open well for construction suitability test as per IS: 456 - 2000 guidelines. Test results inferred that groundwater from the open well was suitable for construction purposes. Groundwater from the site should be checked at regular intervals from the beginning and during construction period to confirm groundwater's construction suitability.

We do not expect construction problems at this site due to soil and groundwater conditions in non rainy seasons. Site's EGL was at about 0.5- to 1.2-M below ERL of road near the site. In order to minimize future site and building flooding from road it was recommended to raise FGL of the site by **at least 0.6-M above ERL** of roads in front of the site. The Finished Floor Level (FFL) of stilt floor should be 0.2-M above FGL of the site. This will minimize rainwater runoff flooding into the site and building.

Backfilling of the foundation excavations should be done with granular soil, and fill should be compacted properly to achieve proper densification to avoid settlements in flooring. Exposed bottom surface of the foundation excavation must be properly compacted with heavy duty rammer or heavy roller to compact the exposed surface that gets loosened by mechanical excavation activities. This is to minimize the settlements that can arise if the loosened soil in foundation excavation is not removed or compacted. New foundations should rest on virgin soil and not on old foundations or filled up soils.

At some boring locations (Boring 2 and 12) soils were in loose state with SPT "N" ≤ 7 even at 2-M inferring possible filled-up shallow pits. Since the site is a large open land, there may some filled-up large diameter open wells or rainwater collection ponds. Therefore, during construction care must be taken to inspect and confirm that the soil foundation level was **dense to very dense weathered rock** and not loose material easy to excavate with back-hoe. In case of columns located at site open wells or pits or ditches or any other filled up pockets that may be encountered should be filled with well compacted lean concrete (PCC) after removal of loose material present inside these areas completely. Excavated sandy soil and weathered rock can be used for back filling and site filling purposes.

All structures have to be designed for higher seismic forces (**Zone III**) due to increased seismic activity in peninsular India in the last decade and half. Seismic events of 7.9 magnitude on April 25, 2015, 6.0 magnitude on May 21, 2014, 8.4 magnitude on April 11, 2012, 7.2 magnitude on June 13, 2010, and 7.6 magnitude on August 11, 2009 with epicenters in Himalayas, Bay of Bengal, and near Andaman Islands were felt at Chennai. It is recommended to provide rigid plinth beams in ground level, shear walls in the structure, and continuous lintels in each floor. For PRASAD ARMSTRONG YEN GEC (P) LTD. CHENNAI 106

columns of the structure. Plinth beams must be designed to be rigid to allow redistribution of loads in case of differential settlements. The site soil profile infers "No" seismic susceptibility. Under a seismic event of 6.5 Richter scale, and peak ground acceleration of 0.08g the total estimated vertical settlement was 0 cms and total horizontal displacement was about 0 cms. Iwasaki liquefaction potential was 0.0 inferring "No Liquefaction." As per IS code for Zone III design horizontal acceleration was 0.08g.

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.



Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

INTRODUCTION

Purpose and Scope

Prasad Armstrong Yen GEC (P) Ltd. performed a geotechnical site investigation at the Proposed Residential Apartment and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram District, TN. The primary purpose of this investigation was to obtain data to develop foundation design recommendations for the proposed villa buildings and Stilt + 7 floors apartment buildings. This investigation was performed to identify variability in soil stratification of the site, and select suitable foundation, and estimate load carrying capacities of the considered foundation. For the proposed buildings typical maximum column load will be about 150 tons. These details were used only for estimating the preliminary foundation size and type of foundation. To accomplish these purposes, the following tasks were performed:

- (1) Boring 1 through 27 were drilled 5- to 8-M to explore subsurface stratigraphy and obtain soil and rock samples for laboratory testing;
- (2) Field and laboratory tests were conducted to evaluate the pertinent index and engineering properties of the foundation materials; and
- (3) Engineering analyses were performed to develop foundation design information for the proposed building.

Report Format

The initial sections of this report contain brief descriptions of the field and laboratory phases of our study. A general soils description is then presented, followed by discussions of foundation design recommendations followed by a brief on construction considerations for this project.

FIELD AND LABORATORY INVESTIGATIONS

Exploratory Borings

Soil conditions at the site were explored by Boring 1 through 27. Boring location details are presented on Plate 1. Number and location of borings were selected to cover the proposed buildings area as per the layout plan provided by the client. Boring 1 through 27 were drilled between 5- to 8-M penetration below EGL. Drilling of the borings was terminated after encountering hard stratum with SPT "N" ≥ 75 in at least three successive tests below the expected foundation level or on high core recovery at termination depth. NX TC bit and Diamond bit core barrels were used for drilling through the rocky formation. In most of the borings rock core pieces were recovered at bore termination depth. Groundwater was seen at 2.1-M below EGL in site's open well. Log of Boring are presented on Plate 2 through 28.

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.



Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

Field and Laboratory Tests

Boring was drilled using Calyx drilling unit. In the boring SPT was performed at 1-M interval. Soil samples for laboratory tests were collected from SPT split spoon sampler. SPT consists of driving a standard split spoon sampler, 50.8-mm outside diameter and 35-mm inside diameter into soil under the blows of a drop hammer of 63.5 kg falling weight freely through 75-cm. The number of blows required for 30-cm of penetration of sampler in soil is designated as N value and it is termed as the SPT blow count. Detailed information regarding SPT can be found in the IS: 2131 code of practice.

Soil-testing program was designed to evaluate pertinent index and engineering properties of the foundation soils and rock. During field operations soil samples were collected at 1-M interval either disturbed or undisturbed as the case may be. All soil and rock samples were shipped to our Chennai laboratory where pertinent index properties - grain size analyses, natural water content Atterberg limit tests were performed on collected soil samples. All the test results are tabulated on the Summary of Test Results on Plate 29. Grain size distribution curves of tested soil are presented on Plate 30. Summary of Water Test Results are presented on Plate 31.

GENERAL SOIL CONDITIONS

Topography

Natural topography of the site reflects a relatively flat terrain. Visual observation infers that EGL of the site was about 0.5- to 1.2-M below ERL of road near the site. A few trees and many bushes and shrubs were present in the site. Fencing stones, boundary stones were present along various parts of the site boundaries. Proposed construction will be the first major construction activity to cover this site.

Soil Stratigraphy

Soil stratigraphy disclosed by our field and laboratory investigations of the boring are presented on the Log of Boring on Plate 2 through 28. Soil stratigraphy is based on classification of soil samples recovered from the boring, and our observations during drilling operations. A generalized summary of the major soil strata is tabulated below:

Boring – 1:

<u>Stratum</u>	<u>Penetration, M</u>		<u>Description</u>
	<u>From</u>	<u>To</u>	
I	0	1.0	Brown Gray Fine to Coarse Sand with Silt Gravel and Roots
II	1.0	3.0	White Brown Weathered Rock
III	3.0	5.0+	Brown Blue Jointed Granite

Boring – 2:

<u>Stratum</u>	<u>Penetration, M</u>		<u>Description</u>
	<u>From</u>	<u>To</u>	
I	0	3.0	White Brown Silty Fine to Coarse Sand
II	3.0	7.0+	Gray Brown Weathered Rock

Blampied

Boring – 3:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Red Brown Fine to Medium Sand with Silt
Gray Brown Weathered Rock

Boring – 4:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.0+

Description

Brown Fine to Medium Sand with Silt
Gray Brown Weathered Rock

Boring – 5:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.0+

Description

Brown Silty Fine to Medium Sand
Gray Brown Weathered Rock

Boring – 6:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	2.0
III	2.0	6.0+

Description

Brown Stiff Clay
White Brown Fine to Coarse Sand with
Silt
White Blue Brown Weathered Rock

Boring – 7:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.0+

Description

Brown Silty Fine to Medium Sand with
Gravel
White Blue Brown Weathered Rock

Boring – 8:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Gray Brown Fine to Medium Sand with
Silt and Gravel
White Blue Brown Weathered Rock

Boring – 9:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.0+

Description

Brown Fine to Medium Sand with Silt and
Roots
White Blue Brown Weathered Rock

Boring – 10:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	3.2
III	3.2	5.0+

Description

Brown Silty Fine to Medium Sand with
Roots
Brown Weathered Rock
Gray Granite

For PRASAD ARMSTRONG YEN
GEOTECHNICAL ENGINEERING CONSULTANTS (P) LTD.

Blampy

Boring – 11:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	2.0
III	2.0	7.0+

Description

Brown Silty Fine to Medium Sand with
Roots
Brown Fine to Coarse Sand with Silt
Brown Gray Weathered Rock

Boring – 12:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	2.0
II	2.0	7.0+

Description

White Brown Fine to Coarse Sand with
Silt and Gravel
White Blue Brown Weathered Rock

Boring – 13:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Brown Stiff Clay
Gray Brown Weathered Rock

Boring – 14:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	2.0
II	2.0	7.0+

Description

Brown Fine to Coarse Sand with Silt
White Blue Brown Weathered Rock

Boring – 15:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Brown Fine to Medium Sand with Silt
White Blue Brown Weathered Rock

Boring – 16:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Brown Fine to Medium Sand with Silt
Gray White Brown Weathered Rock

Boring – 17:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.0+

Description

Brown Gray Silty Fine to Medium Sand
with Roots and Gravel
White Blue Brown Weathered Rock

Boring – 18:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Brown Gray Silty Fine to Medium Sand
with Roots and Gravel
White Blue Brown Weathered Rock

Boring – 19:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.0+

Description

Gray Brown Fine to Medium Sand with
Silt and Gravel
White Blue Brown Weathered Rock

Boring – 20:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Brown Fine to Medium Sand with Silt
and Roots
Gray White Brown Weathered Rock

Boring – 21:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	2.0
III	2.0	8.0+

Description

Gray Brown Very Stiff Silty Clay
White Brown Fine to Coarse Sand with
Silt
White Blue Brown Weathered Rock

Boring – 22:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	2.0
II	2.0	7.0+

Description

Brown Silty Fine to Medium Sand
White Blue Brown Weathered Rock

Boring – 23:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	6.6+

Description

Brown Silty Fine to Medium Sand
White Blue Brown Weathered Rock

Boring – 24:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	2.0
II	2.0	7.0+

Description

Gray Brown Silty Fine to Medium Sand
White Blue Brown Weathered Rock

Boring – 25:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	7.0+

Description

Gray Brown Silty Fine to Medium Sand
White Blue Brown Weathered Rock

Boring – 26:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	2.0
II	2.0	7.0+

Description

Gray White Brown Fine to Coarse Sand
With Gravel
White Blue Brown Weathered Rock

Boring – 27:

Stratum	Penetration, M		Description
	From	To	
I	0	1.0	Brown Fine to Coarse Sand with Silt
II	1.0	7.0+	White Blue Brown Weathered Rock

Detailed soil descriptions that include textural variations and inclusions are noted on the log of boring presented on Plate 2 through 28.

Interpretation of Soil Properties

Shear strength parameters for cohesionless soils were selected based on the SPT, and grain size distribution analyses. Shear strength parameters for cohesive soils were selected based on the SPT results. Unit weight (soil density) profiles of soils in the borings were developed from estimated values based on correlations of unit weight with particle size gradation and field test results (Bowles, 1982.)

Recommendations presented herein for the proposed buildings were based on the soil properties encountered in Boring 3 and 22. **There may be a need to drill additional borings to investigate soil variability if encountered during the foundation work.** Based on the field and laboratory test results the following are the properties for soils encountered in the boring.

Boring – 1:

Stratum	Penetration, M		Properties
	From	To	
I	0	1.0	$\phi = 31^\circ$; $\gamma_{sat} = 1.7 \text{ tons/M}^3$
II	1.0	3.0	$\phi = 39^\circ$; $\gamma_{sat} = 2.25 \text{ tons/M}^3$
III	3.0	5.0+	$\phi = 40^\circ$; $\gamma_{sat} = 2.3 \text{ tons/M}^3$

Boring – 2:

Stratum	Penetration, M		Properties
	From	To	
Ia	0	1.0	$\phi = 30^\circ$; $\gamma_{sat} = 1.6 \text{ tons/M}^3$
Ib	1.0	1.75	$\phi = 32^\circ$; $\gamma_{sat} = 1.7 \text{ tons/M}^3$
Ic	1.75	3.0	$\phi = 26^\circ$; $\gamma_{sat} = 1.5 \text{ tons/M}^3$
IIa	3.0	4.0	$\phi = 38^\circ$; $\gamma_{sat} = 2.2 \text{ tons/M}^3$
IIb	4.0	7.0+	$\phi = 39^\circ$; $\gamma_{sat} = 2.25 \text{ tons/M}^3$

Boring – 3:

Stratum	Penetration, M		Properties
	From	To	
I	0	1.0	$\phi = 33^\circ$; $\gamma_{sat} = 1.75 \text{ tons/M}^3$
IIa	1.0	3.0	$\phi = 33^\circ$; $\gamma_{sat} = 1.75 \text{ tons/M}^3$
IIb	3.0	4.0	$\phi = 38^\circ$; $\gamma_{sat} = 2.2 \text{ tons/M}^3$
IIc	4.0	7.0+	$\phi = 39^\circ$; $\gamma_{sat} = 2.25 \text{ tons/M}^3$

Boring – 4:

Stratum	Penetration, M		Properties
	From	To	
I	0	1.0	$\phi = 27^\circ$; $\gamma_{sat} = 1.55 \text{ tons/M}^3$
IIa	1.0	2.0	$\phi = 33^\circ$; $\gamma_{sat} = 1.75 \text{ tons/M}^3$

IIb	2.0	5.0
IIc	5.0	6.0+

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

$$\phi = 40^{\circ}; \gamma_{\text{sat}} = 2.3 \text{ tons/M}^3$$

Boring – 5:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	4.0
IIc	4.0	5.0
IId	5.0	6.0+

Properties

$$\phi = 30^{\circ}; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$$

$$\phi = 32^{\circ}; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$$

$$\phi = 37^{\circ}; \gamma_{\text{sat}} = 2.1 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

$$\phi = 40^{\circ}; \gamma_{\text{sat}} = 2.3 \text{ tons/M}^3$$

Boring – 6:

Stratum	Penetration, M	
	From	To
I	0	1.0
II	1.0	2.0
IIIa	2.0	5.0
IIIb	5.0	6.0+

Properties

$$C_u = 6 \text{ tons/M}^2; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 34^{\circ}; \gamma_{\text{sat}} = 1.85 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

$$\phi = 40^{\circ}; \gamma_{\text{sat}} = 2.3 \text{ tons/M}^3$$

Boring – 7:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	3.0
IIc	3.0	5.0
IId	5.0	6.0+

Properties

$$\phi = 28^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 32^{\circ}; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

$$\phi = 40^{\circ}; \gamma_{\text{sat}} = 2.3 \text{ tons/M}^3$$

Boring – 8:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	4.0
IIc	4.0	7.0+

Properties

$$\phi = 30^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 32^{\circ}; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 9:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	3.0
IIc	3.0	6.0+

Properties

$$\phi = 29^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 32^{\circ}; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 10:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	3.2
III	3.2	5.0+

Properties

$$\phi = 31^{\circ}; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$$

$$\phi = 33^{\circ}; \gamma_{\text{sat}} = 1.75 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 42^{\circ}; \gamma_{\text{sat}} = 2.35 \text{ tons/M}^3$$

PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Bhargava
Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

Boring – 11:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
II	1.0	2.0
IIIa	2.0	3.0
IIIb	3.0	7.0+

Properties

$\phi = 29^\circ; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$
 $\phi = 31^\circ; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$
 $\phi = 37^\circ; \gamma_{\text{sat}} = 2.1 \text{ tons/M}^3$
 $\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 12:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	2.0
IIa	2.0	3.0
IIb	3.0	7.0+

Properties

$\phi = 27^\circ; \gamma_{\text{sat}} = 1.55 \text{ tons/M}^3$
 $\phi = 38^\circ; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$
 $\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 13:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
IIa	1.0	2.0
IIb	2.0	4.0
IIc	4.0	7.0+

Properties

$C_u = 5 \text{ tons/M}^2; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$
 $\phi = 32^\circ; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$
 $\phi = 38^\circ; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$
 $\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 14:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
Ia	0	1.0
Ib	1.0	2.0
IIa	2.0	3.0
IIb	3.0	7.0+

Properties

$\phi = 27^\circ; \gamma_{\text{sat}} = 1.55 \text{ tons/M}^3$
 $\phi = 35^\circ; \gamma_{\text{sat}} = 1.95 \text{ tons/M}^3$
 $\phi = 36^\circ; \gamma_{\text{sat}} = 2.0 \text{ tons/M}^3$
 $\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 15:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
IIa	1.0	2.0
IIb	2.0	4.0
IIc	4.0	7.0+

Properties

$\phi = 31^\circ; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$
 $\phi = 32^\circ; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$
 $\phi = 38^\circ; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$
 $\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 16:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0
IIa	1.0	2.0
IIb	2.0	3.0
IIc	3.0	4.0
IId	4.0	7.0+

Properties

$\phi = 31^\circ; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$
 $\phi = 29^\circ; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$
 $\phi = 36^\circ; \gamma_{\text{sat}} = 2.05 \text{ tons/M}^3$
 $\phi = 38^\circ; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$
 $\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 17:

<u>Stratum</u>	<u>Penetration, M</u>	
	<u>From</u>	<u>To</u>
I	0	1.0

Properties

$\phi = 30^\circ; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Elampara

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

IIa	1.0	2.0
IIb	2.0	4.0
IIc	4.0	6.0+

$$\phi = 37^{\circ}; \gamma_{\text{sat}} = 2.1 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 18:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	7.0+

Properties

$$\phi = 30^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 34^{\circ}; \gamma_{\text{sat}} = 1.85 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 19:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	6.0+

Properties

$$\phi = 30^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 34^{\circ}; \gamma_{\text{sat}} = 1.85 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 20:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	3.0
IIc	3.0	7.0+

Properties

$$\phi = 31^{\circ}; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$$

$$\phi = 34^{\circ}; \gamma_{\text{sat}} = 1.85 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 21:

Stratum	Penetration, M	
	From	To
I	0	1.0
II	1.0	2.0
IIIa	2.0	3.0
IIIb	3.0	8.0+

Properties

$$C_u = 13 \text{ tons/M}^2; \gamma_{\text{sat}} = 1.75 \text{ tons/M}^3$$

$$\phi = 32^{\circ}; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 22:

Stratum	Penetration, M	
	From	To
Ia	0	1.0
Ib	1.0	2.0
IIa	2.0	3.0
IIb	3.0	4.0
IIc	4.0	7.0+

Properties

$$\phi = 28^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 31^{\circ}; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$$

$$\phi = 33^{\circ}; \gamma_{\text{sat}} = 1.75 \text{ tons/M}^3$$

$$\phi = 38^{\circ}; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

Boring – 23:

Stratum	Penetration, M	
	From	To
I	0	1.0
IIa	1.0	2.0
IIb	2.0	6.6+

Properties

$$\phi = 29^{\circ}; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$$

$$\phi = 34^{\circ}; \gamma_{\text{sat}} = 1.85 \text{ tons/M}^3$$

$$\phi = 39^{\circ}; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$$

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

Boring – 24:

Stratum	Penetration, M		Properties
	From	To	
I	0	2.0	$\phi = 29^\circ; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$
IIa	2.0	3.0	$\phi = 37^\circ; \gamma_{\text{sat}} = 2.1 \text{ tons/M}^3$
IIb	3.0	4.0	$\phi = 38^\circ; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$
IIc	4.0	7.0+	$\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 25:

Stratum	Penetration, M		Properties
	From	To	
I	0	1.0	$\phi = 29^\circ; \gamma_{\text{sat}} = 1.6 \text{ tons/M}^3$
IIa	1.0	2.0	$\phi = 38^\circ; \gamma_{\text{sat}} = 2.2 \text{ tons/M}^3$
IIb	2.0	7.0+	$\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 26:

Stratum	Penetration, M		Properties
	From	To	
Ia	0	1.0	$\phi = 30^\circ; \gamma_{\text{sat}} = 1.65 \text{ tons/M}^3$
Ib	1.0	2.0	$\phi = 32^\circ; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$
IIa	2.0	4.0	$\phi = 37^\circ; \gamma_{\text{sat}} = 2.1 \text{ tons/M}^3$
IIb	4.0	7.0+	$\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

Boring – 27:

Stratum	Penetration, M		Properties
	From	To	
I	0	1.0	$\phi = 32^\circ; \gamma_{\text{sat}} = 1.7 \text{ tons/M}^3$
IIa	1.0	2.0	$\phi = 36^\circ; \gamma_{\text{sat}} = 2.05 \text{ tons/M}^3$
IIb	2.0	7.0+	$\phi = 39^\circ; \gamma_{\text{sat}} = 2.25 \text{ tons/M}^3$

DESIGN INFORMATION

Data from borings indicate presence of weathered rock with high SPT “N” values from shallow depth. For the proposed villa and apartments buildings it was **recommended** to provide **Isolated Column Footing** foundation at 2-M below EGL with at least 1-M thick site filling above EGL. The footing should have at least 3-M of **embedment around the footings**. A minimum footing width of 1.5-M was considered in analysis. The ultimate bearing capacity of the soil was estimated as per IS: 6403 Code of Practice Method using the following equation and soil parameters presented above sections:

$$q_{\text{ult}} = CN_c s_c d_c i_c + q(N_q - 1) s_q d_q i_q + 0.5 B \gamma' N_\gamma s_\gamma d_\gamma i_\gamma$$

Where

- B = Width of Footing;
 q_{ult} = Ultimate Bearing Capacity of the Soil;
 C = Avg. Soil Undrained Shear Strength;
 N_c, N_q & N_γ = Bearing Capacity Factors;
 q = Eff. Vertical Pressure at Footing Level

- γ' = Eff. Unit Weight of Soil;
 s_c, s_q, s_γ = Shape Factors;
 d_c, d_q, d_γ = Depth Factors;
 i_c, i_q, i_γ = Inclination Factors; and

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS

Blampied

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

For the considered foundation the estimated ultimate and recommended allowable capacities were 89 and 25 tons/M², respectively. Estimated total settlement was about 6 mm, less than 60 mm, the IS: 1904 - 2006 code limiting settlement for isolated column footings of framed structures with panel walls on granular soil. All the footings should be interconnected in both directions. It was also recommended to provide continuous lintels in each floor for better resistance to seismic forces and differential settlements. In case of footings on or near the filled open wells or locations with loose soils at 2-M level then the loose soils upto lower level hard layer should be replaced with well compacted lean concrete. Also footings around these wells should be made into "Combined Footings" with a maximum bearing pressure limited to 15 tons/M². Pile foundation for these filled up open well areas was not recommended as the installation of piles into these hard rocky formation will be very difficult. Foundation capacity calculations were presented on Plate 32.

GROUNDWATER

Groundwater was present in the borings at highly variable depths from 1-M below EGL to completely dry borings. This is very likely due to recent rains and presence of rocky formation at variable depth in the site. An 8.25-M diameter and unknown depth open well of was present in the site at about 27.7-M from Boring 7 with groundwater at 2.1-M below EGL. Groundwater sample was collected from this open well for construction suitability test as per IS: 456 - 2000 guidelines. Test results inferred that groundwater from the open well was suitable for construction purposes. Groundwater from the site should be checked at regular intervals from the beginning and during construction period to confirm groundwater's construction suitability. Summary of ground water test results is presented on Plate 31.

CONSTRUCTION CONSIDERATIONS

We do not expect construction problems at this site due to soil and groundwater conditions in non rainy seasons. Site's EGL was at about 0.5- to 1.2-M below ERL of road near the site. In order to minimize future site and building flooding from road it was recommended to raise FGL of the site by **at least 0.6-M above ERL** of roads in front of the site. FFL of still floor should be 0.2-M above FGL of the site. This will minimize rainwater runoff flooding into the site and building.

Backfilling of the foundation excavations should be done with granular soil, and fill should be compacted properly to achieve proper densification to avoid settlements in flooring. Exposed bottom surface of the foundation excavation must be properly compacted with heavy duty rammer or heavy roller to compact the exposed surface that gets loosened by mechanical excavation activities. This is to minimize the settlements that can arise if the loosened soil in foundation excavation is not removed or compacted. New foundations should rest on virgin soil and not on old foundations or filled up soils.

At some boring locations (Boring 2, and 12) soils were in loose state with SPT "N" ≤ 7 even at 2-M inferring possible filled-up shallow pits. Since the site is a large open land, there may some filled-up large diameter open wells or rainwater collection ponds. Therefore, during construction care must be taken to inspect and confirm that the soil foundation level was **dense to very dense weathered rock** and not loose material easy to excavate with back-hoe. In case of columns located at site open wells or pits or ditches or any other filled up pockets that may be encountered should be filled with well compacted lean concrete (PCC) after removal of loose material present inside these areas

completely. Excavated sandy soil and weathered rock can be used for back filling and site filling purposes.

All structures have to be designed for higher seismic forces (**Zone III**) due to increased seismic activity in peninsular India in the last decade and half. Seismic events of 7.9 magnitude on April 25, 2015, 6.0 magnitude on May 21, 2014, 8.4 magnitude on April 11, 2012, 7.2 magnitude on June 13, 2010, and 7.6 magnitude on August 11, 2009 with epicenters in Himalayas, Bay of Bengal, and near Andaman Islands were felt at Chennai. It is recommended to provide rigid plinth beams in ground level, shear walls in the structure, and continuous lintels in each floor. Lintels must be integrated into columns of the structure. Plinth beams must be designed to be rigid to allow redistribution of loads in case of differential settlements. The site soil profile infers "No" seismic susceptibility. Under a seismic event of **6.5 Richter scale**, and peak ground acceleration of **0.08g** the total estimated vertical settlement was 0 cms and total horizontal displacement was about 0 cms. Iwasaki liquefaction potential was 0.0 inferring "No Liquefaction." As per IS code for **Zone III** design horizontal acceleration was **0.08g**. Liquefaction Analysis results are presented on Plate 33.

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.



Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

REFERENCES

Bowles, J. E. (1982), Foundation Analysis and Design, 3rd Ed., McGraw-Hill International Book Co.

Bowles, J. E. (1988), Foundation Analysis and Design, 4th Ed., McGraw-Hill International Book Co.

Bureau of Indian Standards (1981), Code of Practice for Determination of Bearing Capacity of Shallow Foundations, IS: 6403-1981, New Delhi.

Bureau of Indian Standards (1998), Code of Practice for Calculation of Settlements for Foundations, Part – 1: Shallow Foundations Subjected to Symmetrical Static Vertical Loads, IS: 8009-1998, New Delhi.

Indian Standard Institution (2006), Code for Design and Construction of Foundations in Soils: General Requirements, IS: 1904 - 2006, New Delhi.


Bureau of Indian Standards (2000), Code of Practice for Plain and Reinforced Concrete, IS: 456-2000, New Delhi.

Bureau of Indian Standards (2002), Criteria for Earthquake Resistant Design of Structures, Part – 1: General Provision and Buildings, IS: 1893 - 2002 (Part 1), New Delhi.


Bureau of Indian Standards (1980), Recommended Procedure for Standard Penetration Test, IS:2131 - 1980, New Delhi.

The Indian Road Congress (2000), Standard Specifications and Code of Practice for Road Bridges IRC: 78 – 2000, Section: VII – Foundations and Substructures, New Delhi.

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.



Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

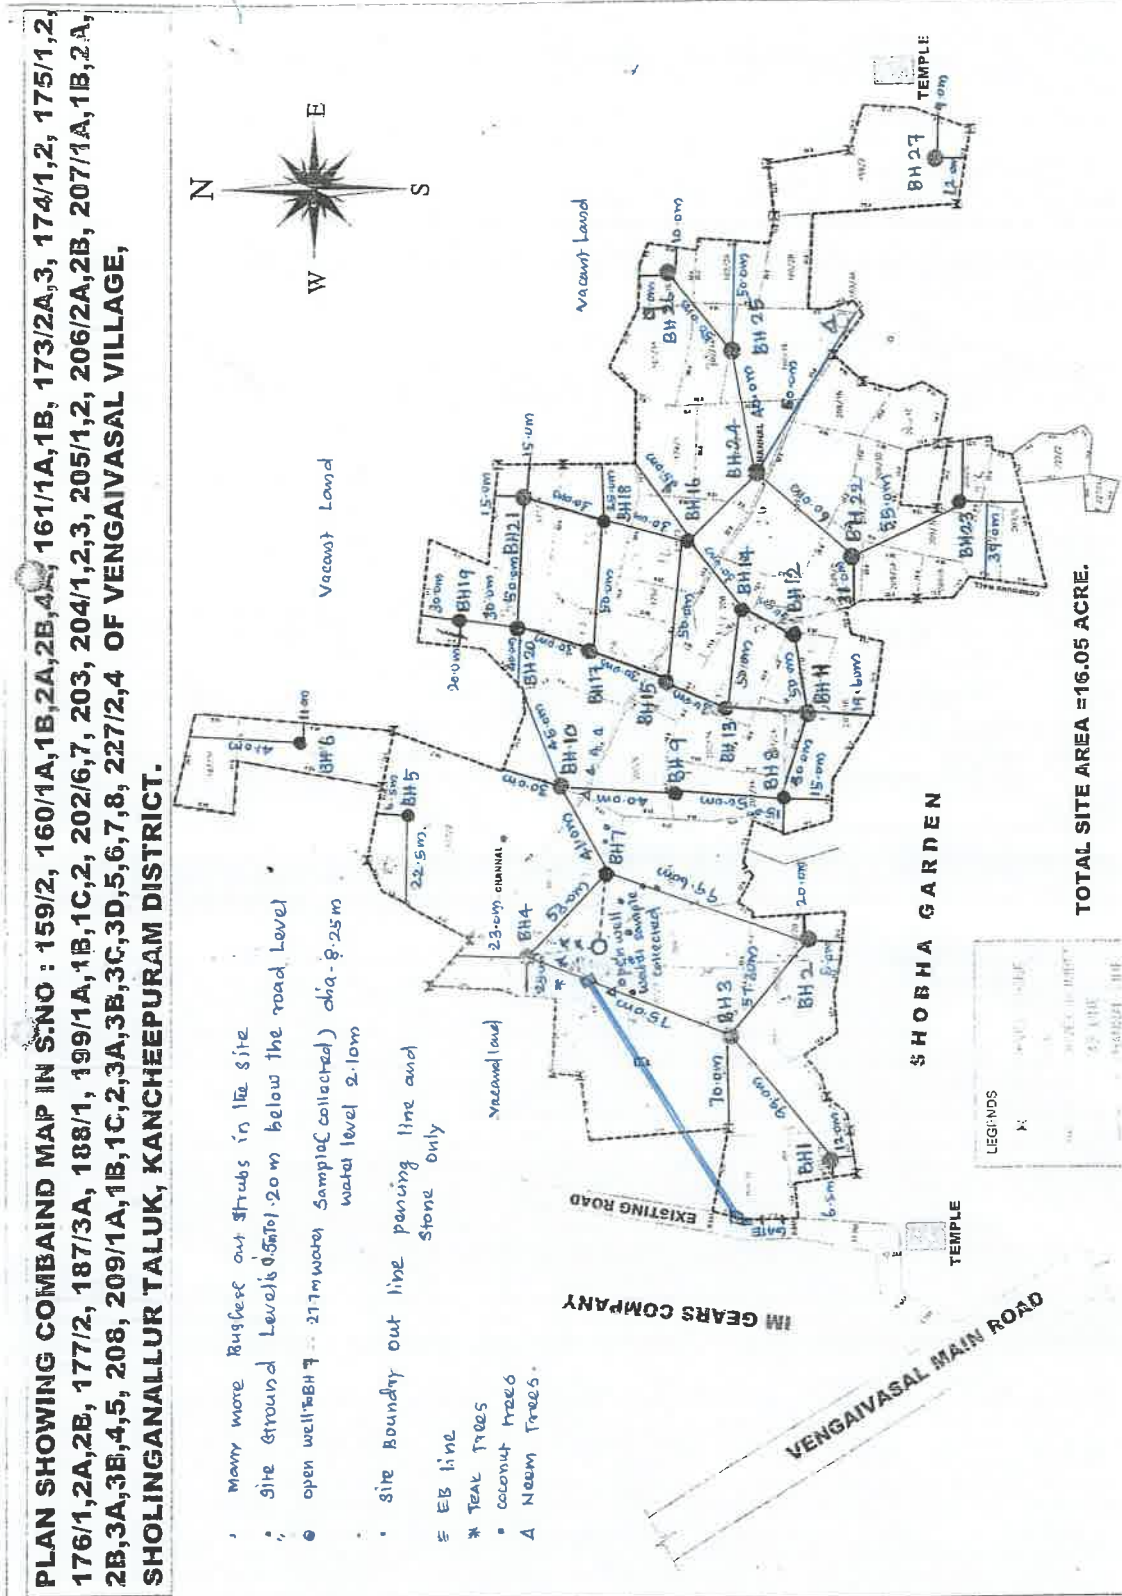

Site EGL = 0.5- to 1.2-M Below ERL Road In Front of Site.

SITE PLAN WITH BORE LOCATION DETAILS

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS

PLATE 1

Chandrasekhar

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/20065
Managing Director

(Not To Scale)

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 1
Started on: 30-11-'18
Final Depth: 5.0-M

Type of Boring: Calyx Drill
Ended on: 30-11-'18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN GRAY FINE TO COARSE SAND with silt, gravel and roots (To 1.0-M) ($N_{avg} = 14$) 0.0- to 1.0-m - $\phi = 31^\circ$; $\gamma_t = 1.7 \text{ tons/M}^3$ -NX TC bit drilling from 1-m	SPT @ 0.25 M 4/6/8 = 14 Blows	10			◆		
2.0	WHITE BROWN WEATHERED ROCK (To 3.0-M) -drilled from 1- to 2-m in 40 minutes -NX Diamond bit drilling from 2-m	SPT @ 1 M (SNR) 2 cms for 20 Blows (Hammer Rebound) SPT @ 2 M (SNR) 1 cm for 10 Blows (Hammer Rebound)						
3.0	1.0- to 3.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 3 M (SNR) 0.5 cms for 5 Blows (Hammer Rebound)						
4.0	BROWN BLUE JOINTED GRANITE (Below 3.0-M) -drilled from 3- to 4-m in 140 minutes -61 cms rock core recovered drilling to 4-m	SPT @ 4 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
5.0	3.0- to 5.0-m - $\phi = 40^\circ$; $\gamma_t = 2.3 \text{ tons/M}^3$ ($N_{avg} >> 100$) -drilled from 4- to 5-m in 115 minutes -73 cms rock core recovered drilling to 5-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
7.0								
8.0								
9.0								
10.0								

BORE HOLE TERMINATED AT 5.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size


LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiyasaal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 2
Started on: 29-11-18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 29-11-18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	WHITE BROWN SILTY FINE TO COARSE SAND (To 3.0-M) $0.0\text{- to }1.0\text{-m} - \phi = 30^\circ; \gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 3/4/6 = 10 Blows SPT @ 1 M 5/7/10 = 17 Blows						
2.0	$1.0\text{- to }1.75\text{-m} - \phi = 32^\circ; \gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 17$)	SPT @ 2 M 2/2/5 = 7 Blows						
3.0	$1.75\text{- to }3.0\text{-m} - \phi = 26^\circ; \gamma_t = 1.5 \text{ tons/M}^3$ ($N_{avg} = 7$)	SPT @ 3 M 2 cms for 10 Blows						
4.0	GRAY BROWN WEATHERED ROCK (Below 3.0-M) $3.0\text{- to }4.0\text{-m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	2 cms for 10 Blows (Hammer Rebound) SPT @ 4 M (SNR) 1 cm for 10 Blows						
5.0	-NX TC bit drilling from 4-m drilled from 4- to 5-m in 30 minutes -NX Diamond bit drilling from 5-m $4.0\text{- to }7.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	1 cm for 10 Blows (Hammer Rebound) SPT @ 5 M (SNR) 1 cm for 10 Blows						
6.0	drilled from 5- to 6-m in 60 minutes wea. rock pieces recovered drilling to 6-m	0 cms for 5 Blows (Hammer Rebound) SPT @ 6 M (SNR) 0.5 cms for 5 Blows						
7.0	drilled from 6- to 7-m in 75 minutes 25 cms gray rock core recovered drilling to 7-m	0 cms for 5 Blows (Hammer Rebound) SPT @ 7 M (SNR) 0 cms for 5 Blows						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 3
Started on: 29-11-18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 29-11-18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	RED BROWN FINE TO MEDIUM SAND with silt (To 1.0-M) $0.0\text{-to } 1.0\text{-m} - \phi = 33^\circ; \gamma_t = 1.75 \text{ tons/M}^3$ ($N_{avg} = 23$)	SPT @ 0.25 M 4/7/16 = 23 Blows SPT @ 1 M 10/10/13 = 23 Blows	○			■		
2.0	GRAY BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{-to } 3.0\text{-m} - \phi = 33^\circ; \gamma_t = 1.75 \text{ tons/M}^3$ ($N_{avg} = 24$)	SPT @ 2 M 4/7/18 = 25 Blows	⊕			◆		
3.0		SPT @ 3 M 30/ 3 cms for 10 Blows						
4.0	$3.0\text{-to } 4.0\text{-m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$) NX TC bit drilling from 4-m	2 cms for 10 Blows (Hammer Rebound) SPT @ 4 M (SNR) 0.5 cms for 10 Blows						
5.0	drilled from 4- to 5-m in 30 minutes NX Diamond bit drilling from 5-m $4.0\text{-to } 7.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0 cms for 5 Blows (Hammer Rebound) SPT @ 5 M (SNR) 1 cm for 10 Blows						
6.0	drilled from 5- to 6-m in 40 minutes	1 cm for 10 Blows (Hammer Rebound) SPT @ 6 M (SNR) 0.5 cms for 5 Blows						
7.0	drilled from 6- to 7-m in 50 minutes 29 cms gray rock core recovered drilling to 7-m	0 cms for 5 Blows (Hammer Rebound) SPT @ 7 M (SNR) 0 cms for 5 Blows						
8.0		(Hammer Rebound)						
9.0								
10.0								

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 4
Started on: 29-11-'18
Final Depth: 6.0-M

Type of Boring: Calyx Drill
Ended on: 29-11-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN FINE TO MEDIUM SAND with silt (To 1.0-M) $0.0\text{--}1.0\text{-m} - \phi = 27^\circ; \gamma_t = 1.55 \text{ tons/M}^3$ ($N_{avg} = 6$)	SPT @ 0.25 M 2/2/4 = 6 Blows SPT @ 1 M 6/9/15 = 24 Blows						
2.0	GRAY BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{--}2.0\text{-m} - \phi = 33^\circ; \gamma_t = 1.75 \text{ tons/M}^3$ ($N_{avg} = 24$)	SPT @ 2 M 3 cms for 15 Blows						
3.0	NX TC bit drilling from 3-m $2.0\text{--}5.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0.5 cms for 5 Blows (Hammer Rebound) SPT @ 3 M (SNR) 1.5 cms for 15 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0	drilled from 3- to 4-m in 35 minutes NX Diamond bit drilling from 4-m	SPT @ 4 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	drilled from 4- to 5-m in 60 minutes 29 cms wea. rock core recovered drilling to 5-m $5.0\text{--}6.0\text{-m} - \phi = 40^\circ; \gamma_t = 2.3 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
6.0	drilled from 5- to 6-m in 90 minutes 60 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0								
8.0								
9.0								
10.0								

For PRASAD ARMSTRONG YEN
 GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Blasquez

Dr. B. Ramprasad
 ME, PhD (Texas A&M)
 Reg. No. GTE/2024/210055
 Managing Director

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 5
Started on: 30-11-18
Final Depth: 6.0-M

Type of Boring: Calyx Drill
Ended on: 30-11-18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	BROWN SILTY FINE TO MEDIUM SAND (To 1.0-M) $0.0\text{- to }1.0\text{-m} - \phi = 30^\circ; \gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 3/4/6 = 10 Blows SPT @ 1 M 5/7/8 = 15 Blows	○			◆	■	
1.0			○			◆	■	
	GRAY BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{- to }2.0\text{-m} - \phi = 32^\circ; \gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 15$)	SPT @ 2 M 13/30/ 6 cms for 15 Blows 1 cm for 5 Blows (Hammer Rebound)			○	◆	■	
2.0						◆	■	
	NX TC bit drilling from 3-m $2.0\text{- to }4.0\text{-m} - \phi = 37^\circ; \gamma_t = 2.1 \text{ tons/M}^3$ ($N_{avg} \sim 100$)	SPT @ 3 M 6 cms for 15 Blows 1 cm for 5 Blows (Hammer Rebound)				◆	■	
3.0						◆	■	
	drilled from 3- to 4-m in 35 minutes NX Diamond bit drilling from 4-m $4.0\text{- to }5.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 4 M (SNR) 1.5 cms for 15 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0								
	drilled from 4- to 5-m in 60 minutes 19 cms wea. rock core recovered drilling to 5-m $5.0\text{- to }6.0\text{-m} - \phi = 40^\circ; \gamma_t = 2.3 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0								
	drilled from 5- to 6-m in 90 minutes 62 cms rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0								
7.0								
8.0								
9.0								
10.0								

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Blamuse

Dr. B. Ramprasad
MS, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS=UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS=Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 6
Started on: 30-11-18
Final Depth: 6.0-M

Type of Boring: Calyx Drill
Ended on: 30-11-18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN STIFF CLAY (To 1.0-M) 0.0- to 1.0-m - $C_u = 6 \text{ tons/M}^2$; $\gamma_i = 1.6 \text{ tons/M}^3$ ($N_{avg} \sim 10$)	SPT @ 0.25 M 3/4/10 = 14 Blows SPT @ 1 M 9/15/18 = 33 Blows	10	15	18	+	+	+
2.0	WHITE BROWN FINE TO COARSE SAND with silt (To 2.0-M) 1.0- to 2.0-m - $\phi = 34^\circ$; $\gamma_i = 1.85 \text{ tons/M}^3$ ($N_{avg} = 33$)	SPT @ 2 M 2 cms for 10 Blows						
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 2.0-M)	1 cm for 10 Blows (Hammer Rebound)						
3.0	-NX TC bit drilling from 2.4- to 3-m in 40 minutes	SPT @ 3 M (SNR) 0.5 cms for 5 Blows						
4.0	-NX Diamond bit drilling from 3-m 2.0- to 5.0-m - $\phi = 39^\circ$; $\gamma_i = 2.25 \text{ tons/M}^3$ ($N_{avg} > 100$)	0 cms for 5 Blows (Hammer Rebound) SPT @ 4 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 3- to 4-m in 100 minutes -31 cms wea. rock core recovered drilling to 4-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 4- to 5-m in 50 minutes -wea. rock pieces recovered drilling to 5-m 5.0- to 6.0-m - $\phi = 40^\circ$; $\gamma_i = 2.3 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 5- to 6-m in 105 minutes -41 cms wea. rock core recovered drilling to 6-m							
8.0								
9.0								
10.0								

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
 M.E., Ph.D. (Texas A&M)
 Reg. No. GTE/2024/2/0055
 Managing Director

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 7
Started on: 1-12-18
Final Depth: 6.0-M

Type of Boring: Calyx Drill
Ended on: 1-12-18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN SILTY FINE TO MEDIUM SAND with gravel (To 1.0-M) $0.0\text{-to } 1.0\text{-m} - \phi = 28^\circ; \gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 8$)	SPT @ 0.25 M 2/4/4 = 8 Blows SPT @ 1 M 4/6/10 = 16 Blows	0			◆	■	
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{-to } 2.0\text{-m} - \phi = 32^\circ; \gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 16$)	SPT @ 2 M 20/ 3 cms for 10 Blows						
3.0	$2.0\text{-to } 3.0\text{-m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	2 cms for 10 Blows (Hammer Rebound) SPT @ 3 M (SNR) 1 cm for 10 Blows						
4.0	NX TC bit drilling from 3- to 3.3-m in 30 minutes NX Diamond bit drilling from 3.3-m drilled from 3.3- to 4-m in 45 minutes 13 cms wea. rock core recovered drilling to 4-m $3.0\text{-to } 5.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	1 cm for 10 Blows (Hammer Rebound) SPT @ 4 M (SNR) 0.5 cms for 5 Blows						
5.0	drilled from 4- to 5-m in 100 minutes 28 cms wea. rock core recovered drilling to 5-m $5.0\text{-to } 6.0\text{-m} - \phi = 40^\circ; \gamma_t = 2.3 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0 cms for 5 Blows (Hammer Rebound) SPT @ 5 M (SNR) 0 cms for 5 Blows						
6.0	drilled from 5- to 6-m in 135 minutes 56 cms wea. rock core recovered drilling to 6-m	0 cms for 5 Blows (Hammer Rebound)						
7.0								
8.0								
9.0								
10.0								

For PRASAD ARMSTRONG YEN
 GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Signature

Dr. B. Ramprasad
 ME, PhD (Texas A&M)
 Reg. No. GTE/2024/2/0055
 Managing Director

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 8
Started on: 5-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 5-12-'18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	GRAY BROWN FINE TO MEDIUM SAND with silt and gravel (To 1.0-M) $0.0\text{--}1.0\text{--m} - \phi = 30^\circ; \gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 2/4/6 = 10 Blows SPT @ 1 M 6/8/10 = 18 Blows				◆		
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{--}2.0\text{--m} - \phi = 32^\circ; \gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 18$)	SPT @ 2 M 4 cms for 10 Blows 2 cms for 10 Blows (Hammer Rebound)				◆		
3.0	1-NX TC bit drilling from 3-m $2.0\text{--}4.0\text{--m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	SPT @ 3 M 3 cms for 10 Blows 2 cms for 10 Blows (Hammer Rebound)				◆		
4.0	drilled from 3- to 4-m in 40 minutes 1-NX Diamond bit drilling from 4-m	SPT @ 4 M (SNR) 1 cm for 10 Blows (Hammer Rebound)						
5.0	drilled from 4- to 5-m in 30 minutes $4.0\text{--}7.0\text{--m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
6.0	drilled from 5- to 6-m in 50 minutes 4 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	drilled from 6- to 7-m in 55 minutes 9 cms wea. rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS=UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS=Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 9

Type of Boring: Calyx Drill

Dia. of Hole: 150 mm

Started on: 4-12-'18

Ended on: 4-12-'18

Field Work In Charge: M Munivel

Final Depth: 6.0-M

Depth to GWS: 2.1-M

Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	BROWN FINE TO MEDIUM SAND with silt and roots (To 1.0-M)	SPT @ 0.25 M 3/3/6 = 9 Blows				■	◆	
1.0	0.0- to 1.0-m - $\phi = 29^\circ$; $\gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 9$)	SPT @ 1 M 6/8/10 = 18 Blows						
	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M)					■		
2.0	1.0- to 2.0-m - $\phi = 32^\circ$; $\gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 18$)	SPT @ 2 M 22/ 3 cms for 10 Blows						
		2 cms for 10 Blows (Hammer Rebound)				■		
3.0	NX TC bit drilling from 3- to 3.4-m in 30 minutes NX Diamond bit drilling from 3.4-m	SPT @ 3 M 6 cms for 15 Blows				◆	■	
	2.0- to 3.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	1 cm for 5 Blows (Hammer Rebound)						
4.0	drilled from 3.4- to 4-m in 30 minutes	SPT @ 4 M (SNR) 0.5 cms for 5 Blows						
	wea. rock pieces recovered drilling to 4-m	0 cms for 5 Blows (Hammer Rebound)						
5.0	drilled from 4- to 5-m in 45 minutes 14 cms wea. rock core recovered drilling to 5-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
	4.0- to 6.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	drilled from 5- to 6-m in 50 minutes							
	12 cms wea. rock core recovered drilling to 6-m							
7.0								
8.0								
9.0								
10.0								

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 10
Started on: 1-12-'18
Final Depth: 5.0-M

Type of Boring: Calyx Drill
Ended on: 1-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN SILTY FINE TO MEDIUM SAND with roots (To 1.0-M) $0.0\text{-} \text{to } 1.0\text{-m} - \phi = 31^\circ; \gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 13$)	SPT @ 0.25 M 4/6/7 = 13 Blows SPT @ 1 M 8/10/14 = 24 Blows						
2.0	BROWN WEATHERED ROCK (To 3.2-M) $1.0\text{-} \text{to } 2.0\text{-m} - \phi = 33^\circ; \gamma_t = 1.75 \text{ tons/M}^3$ ($N_{avg} = 24$)	SPT @ 2 M 6 cms for 15 Blows 1 cm for 5 Blows (Hammer Rebound)						
3.0	2.0- to 3.2-m - $\phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$) -NX TC bit drilling from 3- to 3.2-m in 30 minutes -NX Diamond bit drilling from 3.2-m	SPT @ 3 M (SNR) 1.5 cms for 15 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0	GRAY GRANITE (Below 3.2-M) -drilled from 3.2- to 4-m in 140 minutes -90 cms granite rock core recovered drilling to 4-m $3.2\text{-} \text{to } 5.0\text{-m} - \phi = 42^\circ; \gamma_t = 2.35 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 4 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 100 minutes -80 cms granite rock core recovered drilling to 5-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD. <i>Chandrasekhar</i> Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
7.0								
8.0								
9.0								
10.0								

BORE HOLE TERMINATED AT 5.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 11
Started on: 5-12-18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 5-12-18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN SILTY FINE TO MEDIUM SAND with roots (To 1.0-M) $0.0\text{-to } 1.0\text{-m} - \phi = 29^\circ; \gamma_s = 1.6 \text{ tons/M}^3$ ($N_{avg} = 9$)	SPT @ 0.25 M 3/4/5 = 9 Blows SPT @ 1 M 5/6/8 = 14 Blows						
2.0	BROWN FINE TO COARSE SAND with silt (To 2.0-M) ($N_{avg} = 14$) $1.0\text{-to } 2.0\text{-m} - \phi = 31^\circ; \gamma_s = 1.65 \text{ tons/M}^3$ -NX TC bit drilling from 2-m	SPT @ 2 M 15/28/ 6 cms for 15 Blows 1 cm for 5 Blows (Hammer Rebound)						
3.0	BROWN GRAY WEATHERED ROCK (Below 2.0-M) ($N_{avg} > 75$) $2.0\text{-to } 3.0\text{-m} - \phi = 37^\circ; \gamma_s = 2.1 \text{ tons/M}^3$ -drilled from 2- to 3-m in 35 minutes -NX Diamond bit drilling from 3-m	SPT @ 3 M (SNR) 1 cm for 10 Blows 0.5 cms for 5 Blows (Hammer Rebound)						
4.0	-drilled from 3- to 4-m in 55 minutes -9 cms wea. rock core recovered drilling to 4-m	SPT @ 4 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 45 minutes $3.0\text{-to } 7.0\text{-m} - \phi = 39^\circ; \gamma_s = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 45 minutes -wea. rock pieces recovered drilling to 6-m	SPT @ 6 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 60 minutes -24 cms rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/20055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiyasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 12
Started on: 5-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 5-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	WHITE BROWN FINE TO COARSE SAND with silt and gravel (To 2.0-M)	SPT @ 0.25 M 2/3/4 = 7 Blows SPT @ 1 M 2/3/4 = 7 Blows	○			◆		
1.0	0.0- to 2.0-m - $\phi = 27^\circ$; $\gamma_t = 1.55 \text{ tons/M}^3$ ($N_{avg} = 7$)		○			◆		
2.0		SPT @ 2 M 3 cms for 10 Blows				◆		
GWL	WHITE BLUE BROWN WEATHERED ROCK (Below 2.0-M)	2 cms for 10 Blows (Hammer Rebound)						
3.0	2.0- to 3.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	SPT @ 3 M 1 cm for 10 Blows (Hammer Rebound)						
	— NX TC bit drilling from 3- to 3.6-m in 40 minutes	1 cm for 10 Blows (Hammer Rebound)						
4.0	— NX Diamond bit drilling from 3.6-m drilled from 3.6- to 4-m in 30 minutes	SPT @ 4 M (SNR) 0.5 cms for 5 Blows (Hammer Rebound)						
	— drilled from 4- to 5-m in 40 minutes	SPT @ 5 M (SNR) 0.5 cms for 5 Blows (Hammer Rebound)						
5.0	— wea. rock pieces recovered drilling to 5-m 3.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0.5 cms for 5 Blows (Hammer Rebound)						
6.0	— drilled from 5- to 6-m in 45 minutes — wea. rock pieces recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	— drilled from 6- to 7-m in 40 minutes — 5 cms rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size


LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 13
Started on: 4-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 4-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN STIFF CLAY (To 1.0-M) 0.0- to 1.0-m - $C_u = 5 \text{ tons/M}^2$; $\gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} \sim 8$)	SPT @ 0.25 M 2/3/5 = 8 Blows SPT @ 1 M 5/8/11 = 19 Blows						
2.0	GRAY BROWN WEATHERED ROCK (Below 1.0-M) 1.0- to 2.0-m - $\phi = 32^\circ$; $\gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 19$)	SPT @ 2 M 28/ 2 cms for 10 Blows 2 cms for 10 Blows (Hammer Rebound)						
3.0	drilled from 3- to 4-m in 25 minutes NX TC bit drilling from 3-m 2.0- to 4.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	SPT @ 3 M 30/ 2 cms for 10 Blows 2 cms for 10 Blows (Hammer Rebound)						
4.0	drilled from 3- to 4-m in 25 minutes NX Diamond bit drilling from 4-m	SPT @ 4 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	drilled from 4- to 5-m in 45 minutes 4.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
6.0	drilled from 5- to 6-m in 45 minutes 12 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	drilled from 6- to 7-m in 40 minutes 14 cms wea. rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS=UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS=Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 14
Started on: 4-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 4-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	BROWN FINE TO COARSE SAND with silt (To 2.0-M)	SPT @ 0.25 M 2/3/3 = 6 Blows						
1.0	0.0- to 1.0-m - $\phi = 27^\circ$; $\gamma_t = 1.55 \text{ tons/M}^3$ ($N_{avg} = 6$)	SPT @ 1 M 4/16/19 = 35 Blows						
2.0	1.0- to 2.0-m - $\phi = 35^\circ$; $\gamma_t = 1.95 \text{ tons/M}^3$ ($N_{avg} = 35$)	SPT @ 2 M 12/20/24 = 44 Blows						
	WHITE BLUE BROWN WEATHERED ROCK (Below 2.0-M)							
3.0	2.0- to 3.0-m - $\phi = 36^\circ$; $\gamma_t = 2.0 \text{ tons/M}^3$ ($N_{avg} = 44$)	SPT @ 3 M (SNR) 1.5 cms for 15 Blows						
	NX TC bit drilling from 3-m	0 cms for 5 Blows (Hammer Rebound)						
4.0	drilled from 3- to 4-m in 40 minutes	SPT @ 4 M (SNR) 0.5 cms for 5 Blows						
	NX Diamond bit drilling from 4-m	0 cms for 5 Blows (Hammer Rebound)						
5.0	drilled from 4- to 5-m in 40 minutes	SPT @ 5 M (SNR) 0 cms for 5 Blows						
	20 cms wea. rock core recovered drilling to 5-m	0 cms for 5 Blows (Hammer Rebound)						
	3.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 6 M (SNR) 0 cms for 5 Blows						
6.0	drilled from 5- to 6-m in 35 minutes	0 cms for 5 Blows (Hammer Rebound)						
	6 cms wea. rock core recovered drilling to 6-m	SPT @ 7 M (SNR) 0 cms for 5 Blows						
7.0	drilled from 6- to 7-m in 50 minutes	0 cms for 5 Blows (Hammer Rebound)						
	21 cms wea. rock core recovered drilling to 7-m							
8.0								
9.0								
11.0								

**For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.**

Signature

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE 2024/2/0055
Managing Director

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 15**Type of Boring:** Calyx Drill**Dia. of Hole:** 150 mm**Started on:** 3-12-18**Ended on:** 3-12-18**Field Work In Charge:** M Munivel**Final Depth:** 7.0-M**Depth to G W S:** 2.1-M**Remarks:** GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	BROWN FINE TO MEDIUM SAND with silt (To 1.0-M)	SPT @ 0.25 M 4/6/8 = 14 Blows						
1.0	0.0- to 1.0-m - $\phi = 31^\circ$; $\gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 14$)	SPT @ 1 M 6/8/10 = 18 Blows						
	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M)							
2.0	1.0- to 2.0-m - $\phi = 32^\circ$; $\gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 18$)	SPT @ 2 M 12/22/ 3 cms for 10 Blows						
		2 cms for 10 Blows (Hammer Rebound)						
3.0	2.0- to 4.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	SPT @ 3 M 3 cms for 10 Blows						
	-NX TC bit drilling from 3- to 3.4-m in 35 minutes -NX Diamond bit drilling from 3.4-m	2 cms for 10 Blows (Hammer Rebound)						
4.0	-drilled from 3.4- to 4-m in 25 minutes	SPT @ 4 M (SNR) 0.5 cms for 10 Blows						
	-4 cms wea. rock core recovered drilling to 4-m	0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 55 minutes -9 cms wea. rock core recovered drilling to 5-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
	4.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 70 minutes -12.5 cms wea. rock core recovered drilling to 6-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 40 minutes -5 cms wea. rock core recovered drilling to 7-m							
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								


BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 16Type of Boring: Calyx DrillDia. of Hole: 150 mmStarted on: 3-12-'18Ended on: 3-12-'18Field Work In Charge: R MurugesanFinal Depth: 7.0-MDepth to G W S: 2.1-MRemarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	BROWN FINE TO MEDIUM SAND with silt (To 1.0-M)	SPT @ 0.25 M 4/6/7 = 13 Blows	①			◆		
1.0	0.0- to 1.0-m - $\phi = 31^\circ$; $\gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 13$)	SPT @ 1 M 3/3/5 = 8 Blows	②			◆		
	GRAY WHITE BROWN WEATHERED ROCK (Below 1.0-M)					◆		
2.0	1.0- to 2.0-m - $\phi = 29^\circ$; $\gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 8$)	SPT @ 2 M 11/28/ 4 cms for 10 Blows			③	◆		
	2.0- to 3.0-m - $\phi = 36^\circ$; $\gamma_t = 2.05 \text{ tons/M}^3$ ($N_{avg} \sim 65$)	4 cms for 10 Blows				◆		
3.0	NX TC bit drilling from 3-m	SPT @ 3 M 3 cms for 10 Blows				◆		
	3.0- to 4.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	2 cms for 10 Blows (Hammer Rebound)				◆		
4.0	drilled from 3- to 4-m in 30 minutes	SPT @ 4 M (SNR) 1.5 cms for 15 Blows				◆		
	NX Diamond bit drilling from 4-m brownish gray color, 4- to 7-m	0 cms for 5 Blows (Hammer Rebound)				◆		
5.0	drilled from 4- to 5-m in 50 minutes	SPT @ 5 M (SNR) 0.5 cms for 10 Blows				◆		
	wea. rock pieces recovered drilling to 5-m	0 cms for 10 Blows (Hammer Rebound)				◆		
6.0	4.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 6 M (SNR) 0.5 cms for 10 Blows				◆		
	drilled from 5- to 6-m in 65 minutes	0 cms for 5 Blows (Hammer Rebound)				◆		
7.0	drilled from 6- to 7-m in 75 minutes	SPT @ 7 M (SNR) 0 cms for 5 Blows				◆		
	wea. rock pieces recovered drilling to 7-m	(Hammer Rebound)				◆		
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size


LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 17
Started on: 2-12-'18
Final Depth: 6.0-M

Type of Boring: Calyx Drill
Ended on: 2-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN GRAY SILTY FINE TO MEDIUM SAND with roots and gravel (To 1.0-M) 0.0- to 1.0-m - $\phi = 30^\circ$; $\gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 3/4/6 = 10 Blows SPT @ 1 M 12/18/ 3 cms for 10 Blows						
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) ($N_{avg} > 75$) 1.0- to 2.0-m - $\phi = 37^\circ$; $\gamma_t = 2.1 \text{ tons/M}^3$ -NX TC bit drilling from 2- to 2.6-m in 40 minutes	2 cms for 10 Blows (Hammer Rebound) SPT @ 2 M (SNR) 1.5 cms for 10 Blows						
3.0	-NX Diamond bit drilling from 2.6-m -drilled from 2.6- to 3-m in 30 minutes -wea. rock pieces recovered drilling to 3-m 2.0- to 4.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	1 cm for 10 Blows (Hammer Rebound) SPT @ 3 M (SNR) 3 cms for 10 Blows 2 cms for 10 Blows (Hammer Rebound) SPT @ 4 M (SNR) 0.5 cms for 5 Blows						
4.0	-drilled from 3- to 4-m in 80 minutes -22 cms wea. rock core recovered drilling to 4-m	0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 65 minutes -25.5 cms wea. rock core recovered drilling to 5-m 4.0- to 6.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 80 minutes -29.5 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
8.0								
9.0								
10.0								

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 18
Started on: 3-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 3-12-'18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN GRAY SILTY FINE TO MEDIUM SAND with roots and gravel (To 1.0-M) $0.0\text{-to } 1.0\text{-m} - \phi = 30^\circ, \gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 3/4/6 = 10 Blows SPT @ 1 M 8/12/17 = 29 Blows						
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{-to } 2.0\text{-m} - \phi = 34^\circ, \gamma_t = 1.85 \text{ tons/M}^3$ ($N_{avg} = 29$)	SPT @ 2 M 3 cms for 10 Blows						
	-NX TC bit drilling from 2- to 2.45-m in 35 minutes	1 cm for 10 Blows (Hammer Rebound)						
3.0	-NX Diamond bit drilling from 2.45-m	SPT @ 3 M (SNR) 0.5 cms for 5 Blows						
	-drilled from 2.45- to 3-m in 30 minutes	0 cms for 5 Blows (Hammer Rebound)						
4.0	-drilled from 3- to 4-m in 65 minutes	SPT @ 4 M (SNR) 0.5 cms for 5 Blows						
	-5 cms wea. rock core recovered drilling to 4-m $2.0\text{-to } 7.0\text{-m} - \phi = 39^\circ, \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 40 minutes	SPT @ 5 M (SNR) 0 cms for 5 Blows						
	-wea. rock pieces recovered drilling to 5-m	(Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 55 minutes	SPT @ 6 M (SNR) 0 cms for 5 Blows						
	-6 cms wea. rock core recovered drilling to 6-m	(Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 40 minutes	SPT @ 7 M (SNR) 0 cms for 5 Blows						
	-wea. rock pieces recovered drilling to 7-m	(Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD. <i>Signature</i> Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/20055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiyasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 19
Started on: 1-12-18
Final Depth: 6.0-M

Type of Boring: Calyx Drill
Ended on: 1-12-18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	GRAY BROWN FINE TO MEDIUM SAND with silt and gravel (To 1.0-M) $0.0\text{-} \text{to } 1.0\text{-m} - \phi = 30^\circ; \gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 3/3/7 = 10 Blows SPT @ 1 M 8/12/16 = 28 Blows						
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{-} \text{to } 2.0\text{-m} - \phi = 34^\circ; \gamma_t = 1.85 \text{ tons/M}^3$ ($N_{avg} = 28$)	SPT @ 2 M (SNR) 1.5 cms for 15 Blows						
	-NX TC bit drilling from 2- to 2.5-m in 45 minutes -NX Diamond bit drilling from 2.5-m	0 cms for 5 Blows (Hammer Rebound)						
3.0	-drilled from 2.5- to 3-m in 40 minutes -wea. rock pieces recovered drilling to 3-m	SPT @ 3 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0	-drilled from 3- to 4-m in 65 minutes -6 cms wea. rock core recovered drilling to 4-m $2.0\text{-} \text{to } 6.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 4 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 40 minutes	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 90 minutes -36 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0								
8.0								
9.0								
10.0								

For PRASAD ARMSTRONG YEN
 GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Signature

Dr. B. Ramprasad
 ME, PhD (Texas A&M)
 Reg. No. GTE/2024/2/0055
 Managing Director

BORE HOLE TERMINATED AT 6.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; $\rightarrow$ = Plastic and Liquid Limits; $\blacklozenge$ = N M C; $\blacksquare$ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaivasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 20
Started on: 2-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 2-12-'18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN FINE TO MEDIUM SAND with silt and roots (To 1.0-M) $0.0\text{ to }1.0\text{-m} - \phi = 31^\circ; \gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 14$)	SPT @ 0.25 M 4/6/8 = 14 Blows SPT @ 1 M 8/10/16 = 26 Blows	①			◆		
2.0	GRAY WHITE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{ to }2.0\text{-m} - \phi = 34^\circ; \gamma_t = 1.85 \text{ tons/M}^3$ ($N_{avg} = 26$)	SPT @ 2 M 30/3 cms for 10 Blows				◆		
		2 cms for 10 Blows (Hammer Rebound)				◆		
3.0	$2.0\text{ to }3.0\text{-m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$) -NX TC bit drilling from 3- to 3.5-m in 35 minutes	SPT @ 3 M (SNR) 1 cm for 15 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0	-NX Diamond bit drilling from 3.5-m drilled from 3.5- to 4-m in 55 minutes -wea. rock pieces recovered drilling to 4-m	SPT @ 4 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 50 minutes -6 cms wea. rock core recovered drilling to 5-m $3.0\text{ to }7.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0.5 cm for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 55 minutes	SPT @ 6 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 60 minutes -28 cms wea. rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS=UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS=Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 21
Started on: 2-12-18
Final Depth: 8.0-M

Type of Boring: Calyx Drill
Ended on: 2-12-18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	GRAY BROWN VERY STIFF SILTY CLAY (To 1.0-M) $0.0\text{-to } 1.0\text{-m} - C_u = 13 \text{ tons/M}^2; \gamma_t = 1.75 \text{ tons/M}^3$ ($N_{avg} = 21$)	SPT @ 0.25 M 4/9/12 = 21 Blows SPT @ 1 M 5/7/10 = 17 Blows	○			+		
2.0	WHITE BROWN FINE TO COARSE SAND with silt (To 2.0-M) ($N_{avg} = 17$) $1.0\text{-to } 2.0\text{-m} - \phi = 32^\circ; \gamma_t = 1.7 \text{ tons/M}^3$ -NX TC bit drilling from 2-m	SPT @ 2 M 3 cms for 10 Blows						
3.0	WHITE BLUE BROWN WEATHERED ROCK (Below 2.0-M) ($N_{avg} > 100$) $2.0\text{-to } 3.0\text{-m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ -drilled from 2- to 3-m in 40 minutes -NX Diamond bit drilling from 3-m	2 cms for 10 Blows (Hammer Rebound) SPT @ 3 M 3 cms for 15 Blows						
4.0	-drilled from 3- to 4-m in 40 minutes	SPT @ 4 M 2 cms for 10 Blows 1 cm for 10 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 50 minutes	SPT @ 5 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
6.0	$3.0\text{-to } 8.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$) -drilled from 5- to 6-m in 45 minutes	SPT @ 6 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 45 minutes	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	-drilled from 7- to 8-m in 35 minutes -wea. rock pieces recovered drilling to 8-m	SPT @ 8 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
9.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD. <i>Signature</i> Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/20055 Managing Director							
10.0								

BORE HOLE TERMINATED AT 8.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS=UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS=Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size


LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 22
Started on: 7-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 7-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: R Murugesan
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN SILTY FINE TO MEDIUM SAND (To 2.0-M) $0.0\text{- to }1.0\text{-m} - \phi = 28^\circ; \gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 8$)	SPT @ 0.25 M 3/4/4 = 8 Blows SPT @ 1 M 5/6/8 = 14 Blows	○			+		
2.0	$1.0\text{- to }2.0\text{-m} - \phi = 31^\circ; \gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 14$)	SPT @ 2 M 7/8/13 = 21 Blows	○			+		
3.0	WHITE GRAY BROWN WEATHERED ROCK (Below 2.0-M) $2.0\text{- to }3.0\text{-m} - \phi = 33^\circ; \gamma_t = 1.75 \text{ tons/M}^3$ ($N_{avg} = 21$)	SPT @ 3 M 30/ 3 cms for 10 Blows						
4.0	-NX TC bit drilling from 3-m $3.0\text{- to }4.0\text{-m} - \phi = 38^\circ; \gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	2 cms for 10 Blows (Hammer Rebound) SPT @ 4 M (SNR) 0.5 cms for 10Blows						
5.0	-drilled from 3- to 4-m in 35 minutes -NX Diamond bit drilling from 4-m -drilled from 4- to 5-m in 55 minutes $4.0\text{- to }5.0\text{-m} - \phi = 39^\circ; \gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0 cms for 5 Blows (Hammer Rebound) SPT @ 5 M (SNR) 0.5 cms for 10Blows						
6.0	-drilled from 5- to 6-m in 70 minutes -11 cms wea. rock core recovered drilling to 6-m	0 cms for 5 Blows (Hammer Rebound) SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 65 minutes -13 cms wea. rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
11.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; + + = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 23
Started on: 7-12-'18
Final Depth: 6.6-M

Type of Boring: Calyx Drill
Ended on: 7-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN SILTY FINE TO MEDIUM SAND (To 1.0-M) $0.0\text{-} \text{to } 1.0\text{-m} - \phi = 29^\circ; \gamma_s = 1.6 \text{ tons/M}^3$ ($N_{avg} = 10$)	SPT @ 0.25 M 3/4/6 = 10 Blows SPT @ 1 M 8/12/16 = 28 Blows						
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{-} \text{to } 2.0\text{-m} - \phi = 34^\circ; \gamma_s = 1.85 \text{ tons/M}^3$ ($N_{avg} = 28$)	SPT @ 2 M (SNR) 1 cm for 10 Blows 1 cm for 10 Blows (Hammer Rebound) SPT @ 3 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound) SPT @ 4 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
3.0	-drilled from 2- to 3-m in 40 minutes -NX TC bit drilling from 2-m							
4.0	-drilled from 3- to 4-m in 55 minutes $2.0\text{-} \text{to } 6.6\text{-m} - \phi = 39^\circ; \gamma_s = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 65 minutes -rock pieces recovered drilling to 5-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 80 minutes -15 cms wea. rock core recovered drilling to 6-m	SPT @ 6.6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 6.6-m in 45 minutes -6 cms wea. rock core recovered drilling to 6.6-m							
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 6.6-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; $\rightarrow$ = Plastic and Liquid Limits; $\blacklozenge$ = N M C; $\blacksquare$ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiyasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 24
Started on: 7-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 7-12-'18
Depth to GWS: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
	GRAY BROWN SILTY FINE TO MEDIUM SAND (To 2.0-M)	SPT @ 0.25 M 3/4/5 = 9 Blows						
1.0	0.0- to 2.0-m - $\phi = 29^\circ$; $\gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 9$)	SPT @ 1 M 4/5/5 = 10 Blows						
2.0		SPT @ 2 M 18/ 4 cms for 10 Blows						
	WHITE BLUE BROWN WEATHERED ROCK (Below 2.0-M)	3 cms for 10 Blows (Hammer Rebound)						
3.0	2.0- to 3.0-m - $\phi = 37^\circ$; $\gamma_t = 2.1 \text{ tons/M}^3$ ($N_{avg} > 75$)	SPT @ 3 M 25/ 3 cms for 10 Blows						
	-NX TC bit drilling from 3-m	2 cms for 10 Blows (Hammer Rebound)						
4.0	3.0- to 4.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	SPT @ 4 M (SNR) 1.5 cms for 15 Blows						
	-drilled from 3- to 4-m in 40 minutes	0 cms for 5 Blows (Hammer Rebound)						
	-NX Diamond bit drilling from 4-m	SPT @ 5 M (SNR) 0.5 cms for 5 Blows						
5.0	-drilled from 4- to 5-m in 50 minutes	0 cms for 5 Blows (Hammer Rebound)						
	-wea. rock pieces recovered drilling to 5-m	SPT @ 6 M (SNR) 0 cms for 5 Blows						
6.0	4.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	0 cms for 5 Blows (Hammer Rebound)						
	-drilled from 5- to 6-m in 65 minutes	SPT @ 7 M (SNR) 0 cms for 5 Blows						
	-wea. rock pieces recovered drilling to 6-m	(Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 50 minutes							
	-wea. rock pieces recovered drilling to 7-m							
8.0								
9.0								
10.0								

**For PRASAD ARMSTRONG YEN
 GEOTECH ENGINEERING CONSULTANTS (P) LTD.**

Signature

Dr. B. Ramprasad
 ME, PhD (Texas A&M)
 Reg. No. GTE/2024/2/0055
 Managing Director

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +--+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 25
Started on: 6-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 6-12-'18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	GRAY BROWN SILTY FINE TO MEDIUM SAND with gravel (To 1.0-M) 0.0- to 1.0-m - $\phi = 29^\circ$; $\gamma_t = 1.6 \text{ tons/M}^3$ ($N_{avg} = 9$)	SPT @ 0.25 M 3/4/5 = 9 Blows SPT @ 1 M 22/ 3 cms for 10 Blows	9			9		
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) 1.0- to 2.0-m - $\phi = 38^\circ$; $\gamma_t = 2.2 \text{ tons/M}^3$ ($N_{avg} > 100$)	2 cms for 10 Blows (Hammer Rebound) SPT @ 2 M (SNR) 2 cms for 20 Blows (Hammer Rebound)						
3.0	-drilled from 2- to 3-m in 40 minutes -NX TC bit drilling from 2-m	SPT @ 3 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0	-drilled from 3- to 4-m in 45 minutes -wea. rock pieces recovered drilling to 4-m 2.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 4 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 40 minutes -wea. rock pieces recovered drilling to 5-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 60 minutes -12 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 55 minutes -20 cms wea. rock core recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +-+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size


LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 26
Started on: 6-12-'18
Final Depth: 7.0-M

Type of Boring: Calyx Drill
Ended on: 6-12-'18
Depth to G W S: 2.1-M

Dia. of Hole: 150 mm
Field Work In Charge: M Munivel
Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	GRAY WHITE BROWN FINE TO COARSE SAND with gravel (To 2.0-M) 0.0- to 1.0-m - $\phi = 30^\circ$; $\gamma_t = 1.65 \text{ tons/M}^3$ ($N_{avg} = 11$)	SPT @ 0.25 M 4/5/6 = 11 Blows SPT @ 1 M 7/8/10 = 18 Blows	10					
2.0	1.0- to 2.0-m - $\phi = 32^\circ$; $\gamma_t = 1.7 \text{ tons/M}^3$ ($N_{avg} = 18$)	SPT @ 2 M 30/ 3 cms for 10 Blows						
3.0	WHITE BLUE BROWN WEATHERED ROCK (Below 2.0-M) -NX TC bit drilling from 3- to 3.55-m in 30 minutes -NX Diamond bit drilling from 3.55-m 2.0- to 4.0-m - $\phi = 37^\circ$; $\gamma_t = 2.1 \text{ tons/M}^3$ ($N_{avg} > 100$)	2 cms for 10 Blows (Hammer Rebound) SPT @ 3 M 4 cms for 10 Blows 3 cms for 10 Blows (Hammer Rebound)						
4.0	-drilled from 3.55- to 4-m in 30 minutes -6.5 cms wea. rock core recovered drilling to 4-m	SPT @ 4 M (SNR) 0.5 cms for 10 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 50 minutes -14.5 cms wea. rock core recovered drilling to 5-m 4.0- to 7.0-m - $\phi = 39^\circ$; $\gamma_t = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 5 M (SNR) 0 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 50 minutes -22 cms wea. rock core recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 55 minutes -35 cms wea. rock core recovered drilling to 9-m	SPT @ 7 M (SNR) 0 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS = UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS = Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

LOG OF BORING

Project: Proposed Residential Apartments and Villa Buildings Site, S. No. 159/2, 160/1A, 1B, 2A, 2B, 4A, 1A, 1B, 2A, 173/3, 174/1, 2, 175/1, 2, 176/1, 2A, 2B, 177/2, 187/3(A), 188/1, 199/1A, 1B, 1C, 2, 202/6, 7, 203, 204/1, 2, 3, 205/1, 2, 206/2A, 2B, 207/1A, 1B, 2A, 2B, 3A, 3B, 4, 5, 208, 209/1A, 1B, 1C, 209/2, 3A, 3B, 3C, 3D, 4A, 4C, 4D, 5, 6, 7, 8, 227/2, 4, Vengaiwasal Village, Tambaram Taluk, Kancheepuram Dist., TN.

Bore Hole No.: 27

Type of Boring: Calyx Drill

Dia. of Hole: 150 mm

Started on: 6-12-'18


Ended on: 6-12-'18

Field Work In Charge: M Munivel

Final Depth: 7.0-M

Depth to G W S: 2.1-M

Remarks: GWL in Open Well.

DEPTH, M	SOIL DESCRIPTION	SPT / VANE & SAMPLE TYPE	SPT "N" PROFILE			INDEX TEST DATA		
			25	50	75	25	50	75
1.0	BROWN FINE TO COARSE SAND with silt (To 1.0-M) $0.0\text{- to }1.0\text{-m} - \phi = 32^\circ; \gamma_i = 1.7 \text{ tons/M}^3$ ($N_{avg} = 16$)	SPT @ 0.25 M 6/8/8 = 16 Blows SPT @ 1 M 12/16/ 4 cms for 10 Blows						
2.0	WHITE BLUE BROWN WEATHERED ROCK (Below 1.0-M) $1.0\text{- to }2.0\text{-m} - \phi = 36^\circ; \gamma_i = 2.05 \text{ tons/M}^3$ ($N_{avg} \sim 62$)	3 cms for 10 Blows (Hammer Rebound) SPT @ 2 M (SNR) 2 cms for 20 Blows (Hammer Rebound)						
	GWL - NX TC bit drilling from 2-m							
3.0	-drilled from 2- to 3-m in 35 minutes -NX Diamond bit drilling from 3-m	SPT @ 3 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
4.0	-drilled from 3- to 4-m in 35 minutes $2.0\text{- to }7.0\text{-m} - \phi = 39^\circ; \gamma_i = 2.25 \text{ tons/M}^3$ ($N_{avg} >> 100$)	SPT @ 4 M (SNR) 0.5 cms for 5 Blows 0 cms for 5 Blows (Hammer Rebound)						
5.0	-drilled from 4- to 5-m in 55 minutes -wea. rock pieces recovered drilling to 5-m	SPT @ 5 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
6.0	-drilled from 5- to 6-m in 40 minutes -wea. rock pieces recovered drilling to 6-m	SPT @ 6 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
7.0	-drilled from 6- to 7-m in 40 minutes -wea. rock pieces recovered drilling to 7-m	SPT @ 7 M (SNR) 0 cms for 5 Blows (Hammer Rebound)						
8.0	For PRASAD ARMSTRONG YEN GEOTECH ENGINEERING CONSULTANTS (P) LTD.  Dr. B. Ramprasad ME, PhD (Texas A&M) Reg. No. GTE/2024/2/0055 Managing Director							
9.0								
10.0								

BORE HOLE TERMINATED AT 7.0-M.

SPT=Standard Penetration Test; DS=Disturbed Sample; UDS=UnDisturbed Sample; WS=Water Sample; SNR=Sample Not Recovered; LS=Liner Sample; +---+ = Plastic and Liquid Limits; ◆ = N M C; ■ = % -75 μ Size

SUMMARY OF TEST RESULTS

Boring No.	Depth, M	w %	PL	LL	-75 μ %	SAND		GRAVEL		IS CLASS.
						Fine%	Medium%	Coarse%	%	
1	0.25	12			5	45	40	10	0	SP
	1.0	SNR								
	2.0	SNR								
	3.0	SNR								
	4.0	SNR	rock	core	pieces					
	5.0	SNR	rock	core	pieces					
2	0.25	8			12					SP-SM SM
	1.0	15			16					
	2.0	15			11	52	24	10	3	
	3.0	10			12	55	19	5	9	
	4.0	SNR								
	5.0	SNR								
	6.0	SNR	rock	pieces						
	7.0	SNR	rock	core	pieces					
3	0.25	8			5					SP-SM SW
	1.0	13			6					
	2.0	9			11	52	23	10	4	
	3.0	8			7	34	21	15	23	
	4.0	SNR								
	5.0	SNR								
	6.0	SNR								
	7.0	SNR	rock	core	pieces					
4	0.25	11			8					SM SP-SM
	1.0	15			12	47	31	8	2	
	2.0	8			9	50	17	24	0	
	3.0	SNR								
	4.0	SNR								
	5.0	SNR	rock	core	pieces					
5	0.25	11			19					SM SM
	1.0	14			11					
	2.0	7			13	57	20	6	4	
	3.0	9			13	56	22	9	0	
	4.0	SNR								
	5.0	SNR	rock	core	pieces					
6	0.25	12	17	43						CL SP-SM SM
	1.0	12			10	53	26	7	4	
	2.0	14			17	48	22	9	4	
	3.0	SNR								
	4.0	SNR	rock	core	pieces					
	5.0	SNR	rock	pieces						
7	0.25	10			16					SM SM
	1.0	17			13	58	23	6	0	
	2.0	8			12	54	24	7	3	
	3.0	SNR								
	4.0	SNR	rock	core	pieces					
	5.0	SNR	rock	core	pieces					
6.0	SNR	rock	core	pieces						

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Bhampal

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 29a

SUMMARY OF TEST RESULTS

Boring No.	Depth, M	w %	PL	LL	-75 μ %	SAND			GRAVEL %	IS CLASS.
						Fine%	Medium%	Coarse%		
8	0.25	15			6					
	1.0	10			6					
	2.0	14			8	41	24	7	20	SP
	3.0	10			17	45	32	6	0	SM
	4.0	SNR								
	5.0	SNR								
	6.0	SNR	rock	core	pieces					
	7.0	SNR	rock	core	pieces					
9	0.25	18			10					
	1.0	15			13					
	2.0	16			13	59	21	5	2	SM
	3.0	9			22	42	16	12	8	SM
	4.0	SNR	rock	pieces						
	5.0	SNR	rock	core	pieces					
	6.0	SNR	rock	core	pieces					
10	0.25	11			12					
	1.0	16			8	41	36	12	3	SP
	2.0	10			9	35	43	13	0	SP-SM
	3.0	SNR								
	4.0	SNR	rock	core	pieces					
	5.0	SNR	rock	core	piece					
11	0.25	17			14					
	1.0	19			7	42	37	13	1	SP
	2.0	8			8	31	21	15	25	SW
	3.0	SNR								
	4.0	SNR	rock	core	pieces					
	5.0	SNR								
	6.0	SNR	rock	pieces						
	7.0	SNR	rock	core	pieces					
12	0.25	12			7					
	1.0	20			5	38	38	14	5	SP
	2.0	17			12	44	15	5	24	SM
	3.0	SNR								
	4.0	SNR								
	5.0	SNR	rock	pieces						
	6.0	SNR	rock	pieces						
	7.0	SNR	rock	core	pieces					
13	0.25	20	17	48						CL
	1.0	19			4					
	2.0	3			12	47	26	8	7	SM
	3.0	4			8	34	15	8	35	SP
	4.0	SNR								
	5.0	SNR								
	6.0	SNR	rock	core	pieces					
	7.0	SNR	rock	core	piece					
14	0.25	11			9					
	1.0	11			5	37	41	16	1	SP
	2.0	20			16	44	17	12	11	SM
	3.0	SNR								
	4.0	SNR								
	5.0	SNR	rock	core	pieces					

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Stamp

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 29b

SUMMARY OF TEST RESULTS

Boring No.	Depth, M	w %	PL	LL	-75µ%	SAND			GRAVEL %	IS CLASS.
						Fine%	Medium%	Coarse%		
14	6.0	SNR	rock	core	pieces					
	7.0	SNR	rock	core	pieces					
15	0.25	9			7					
	1.0	15			5					
	2.0	15			11	43	26	12	8	SP-SM
	3.0	13			14	60	19	5	2	SM
	4.0	SNR	rock	core	piece					
	5.0	SNR	rock	core	pieces					
	6.0	SNR	rock	core	pieces					
	7.0	SNR	rock	core	piece					
16	0.25	9			7					
	1.0	14			14					
	2.0	15			13	44	14	7	22	SM
	3.0	8			5	16	22	11	46	SP
	4.0	SNR								
	5.0	SNR	rock	pieces						
	6.0	SNR								
	7.0	SNR	rock	pieces						
17	0.25	11			13					
	1.0	4			12	56	24	5	3	SM
	2.0	SNR								
	3.0	SNR	rock	pieces						
	4.0	SNR	rock	core	pieces					
	5.0	SNR	rock	core	pieces					
18	0.25	10			6					
	1.0	19			7					
	2.0	4			7	14	9	10	60	GW
	3.0	SNR								
	4.0	SNR	rock	core	piece					
	5.0	SNR	rock	pieces						
	6.0	SNR	rock	core	pieces					
19	0.25	10			9					
	1.0	10			7	39	31	20	3	SP
	2.0	SNR								
	3.0	SNR	rock	pieces						
	4.0	SNR	rock	core	pieces					
	5.0	SNR								
20	0.25	13			8					
	1.0	14			4					
	2.0	7			5	25	21	11	39	SW
	3.0	SNR								
	4.0	SNR	rock	pieces						
	5.0	SNR	rock	core	pieces					
	6.0	SNR								
21	0.25	14	11	36						CL
	1.0	25			7	24				SW
	2.0	28			12	52				SW

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Blampied

PLATE 29c

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

SUMMARY OF TEST RESULTS

Boring No.	Depth, M	w %	PL	LL	-75 μ %	SAND		GRAVEL	IS CLASS.
						Fine%	Medium%	Coarse%	
21	3.0	15			16				SM
	4.0	17			17	53	26	4	
	5.0	SNR							
	6.0	SNR							
	7.0	SNR							
	8.0	SNR	rock	pieces					
22	0.25	12			14				SP SM
	1.0	13			4				
	2.0	23			6	39	31	15	
	3.0	12			15	58	14	5	
	4.0	SNR							
	5.0	SNR							
	6.0	SNR	rock	core	pieces				
	7.0	SNR	rock	core	pieces				
23	0.25	11			11				SP
	1.0	17			6	35	39	13	
	2.0	SNR							
	3.0	SNR							
	4.0	SNR							
	5.0	SNR	rock	pieces					
	6.0	SNR	rock	core	pieces				
24	0.25	14			15				SP SM SM
	1.0	18			8	59	30	3	
	2.0	21			12	68	17	2	
	3.0	18			15	48	28	7	
	4.0	SNR							
	5.0	SNR	rock	pieces					
	6.0	SNR	rock	pieces					
25	0.25	12			17				SP
	1.0	22			8	34	31	20	
	2.0	SNR							
	3.0	SNR							
	4.0	SNR	rock	pieces					
	5.0	SN2R	rock	pieces					
	6.0	SNR	rock	core	pieces				
26	0.25	12			10				SP SP-SM
	1.0	15			5				
	2.0	16			4	45	27	11	
	3.0	8			10	41	27	16	
	4.0	SNR	rock	core	pieces				
	5.0	SNR	rock	core	pieces				
	6.0	SNR	rock	core	pieces				
27	0.25	11			7				SM
	1.0	16			18	65	15	1	
	2.0	SNR							
	3.0	SNR							
	4.0	SNR							

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Prasad

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 29d

SUMMARY OF TEST RESULTS

Boring	Depth,	w %	PL	LL	-75µ%	SAND			GRAVEL	IS
No.	M					Fine%	Medium%	Coarse%	%	CLASS.
27	5.0	SNR	rock	pieces						
	6.0	SNR	rock	pieces						
	7.0	SNR	rock	pieces						

FREE SWELL INDEX TEST RESULTS


BORE NO.	DEPTH, M	FREE SWELL INDEX, %
6	0.25	183
13	0.25	233
21	0.25	150

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.


Blamp

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

Grain Size Distribution Curves
Boring 1 & 2

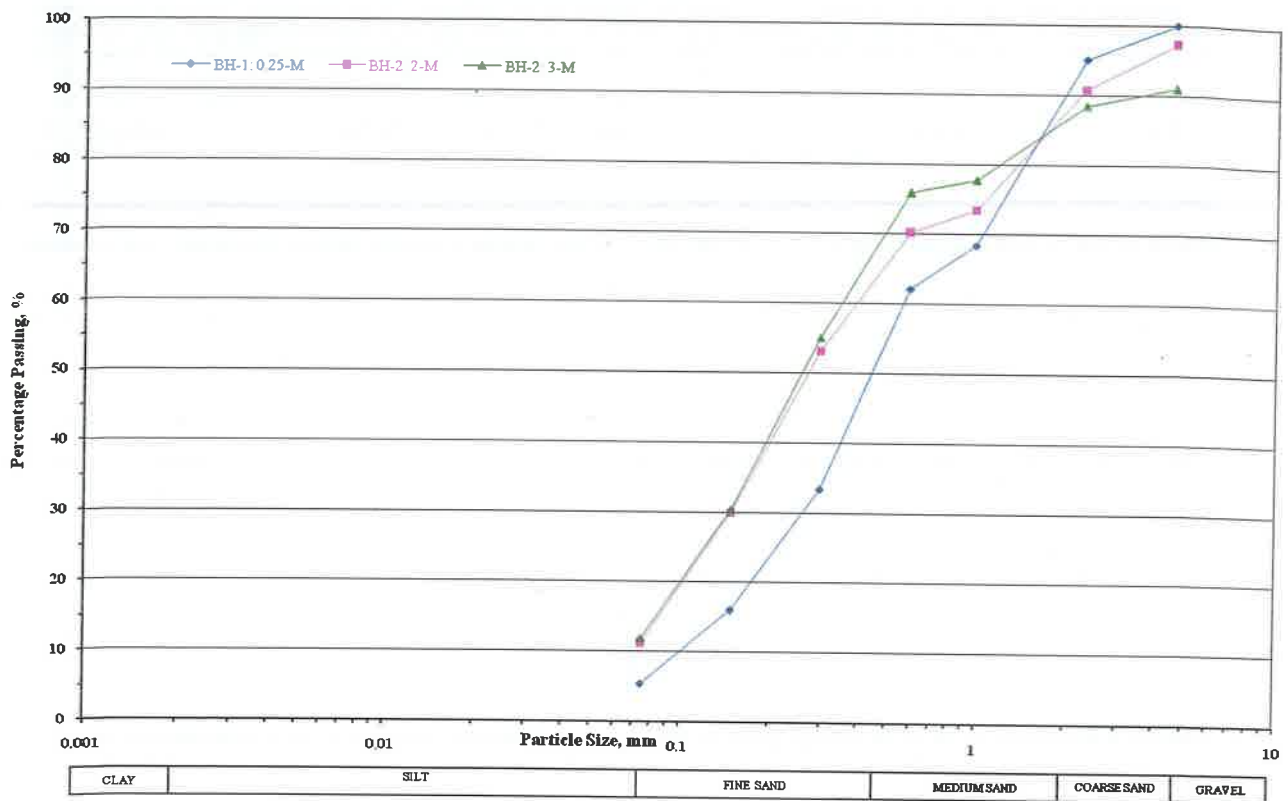



Grain Size Distribution Curves
Boring 3 & 4

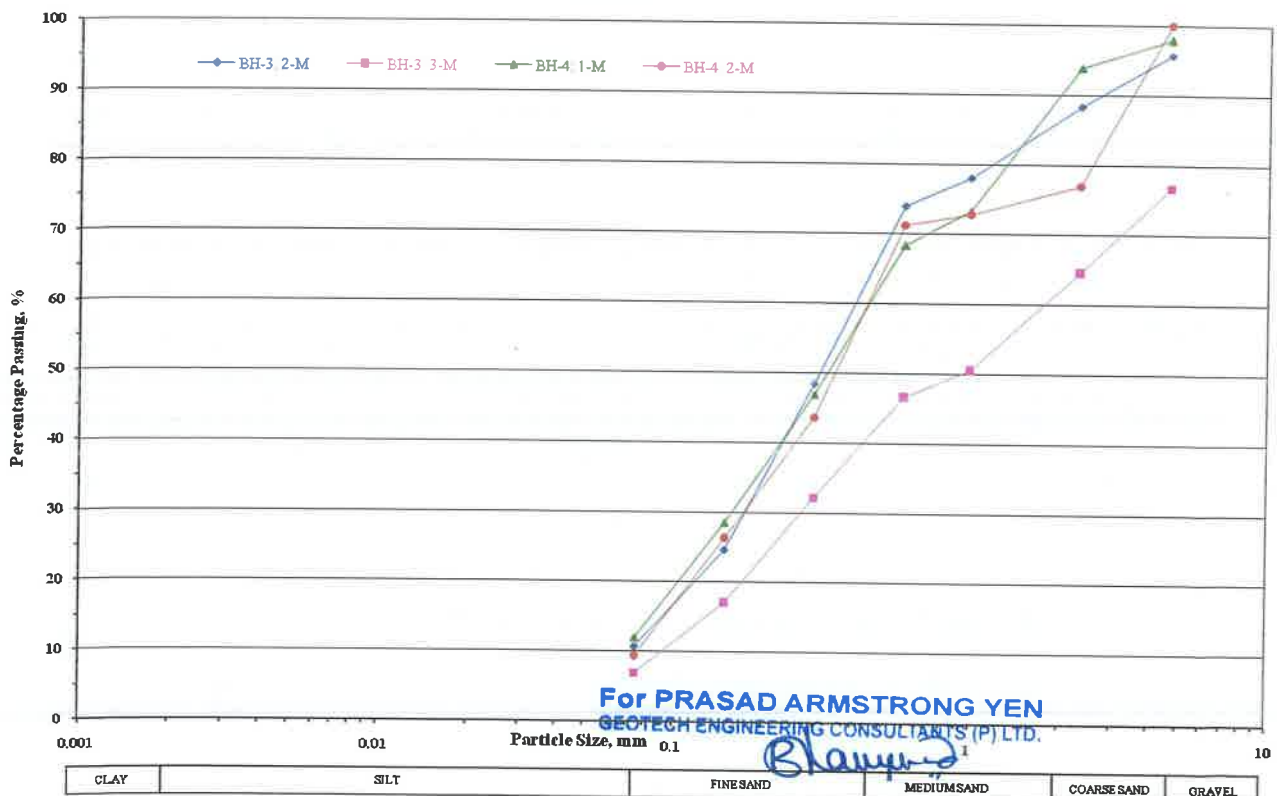

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director



PLATE 30a

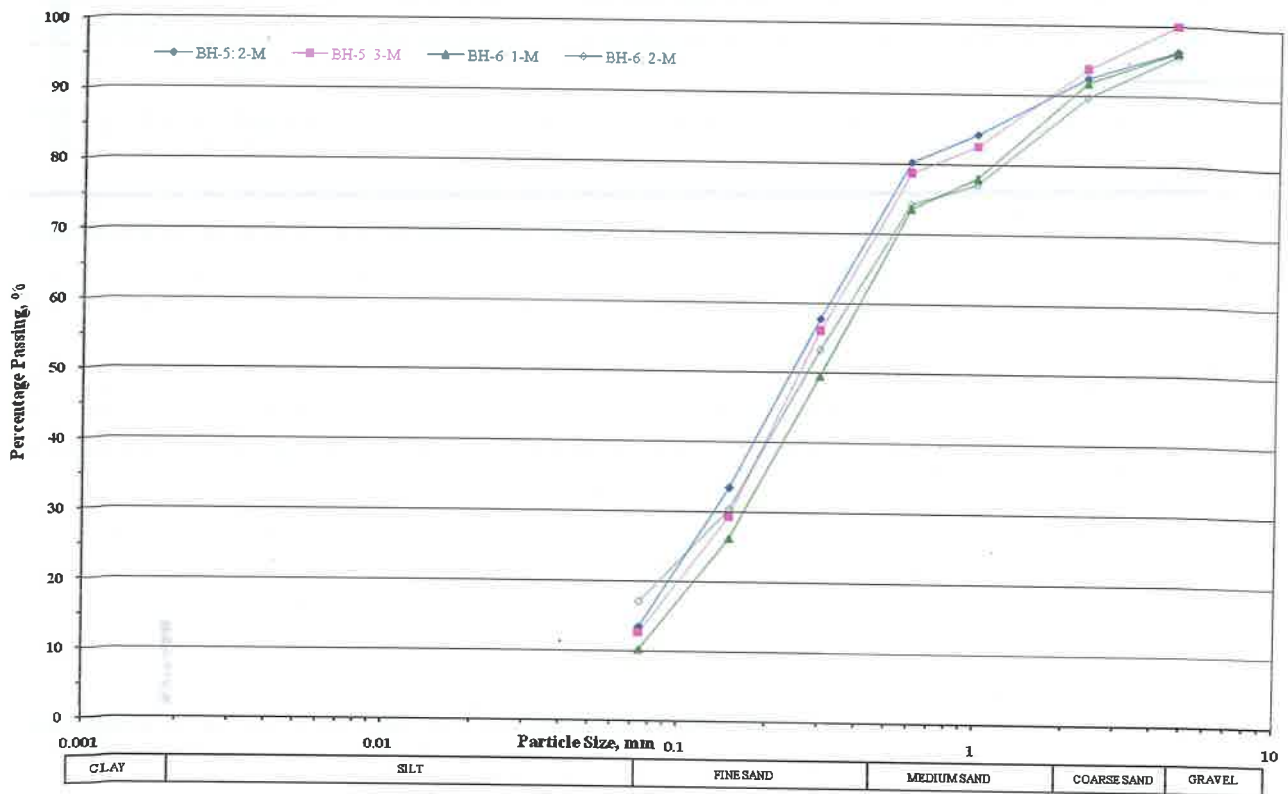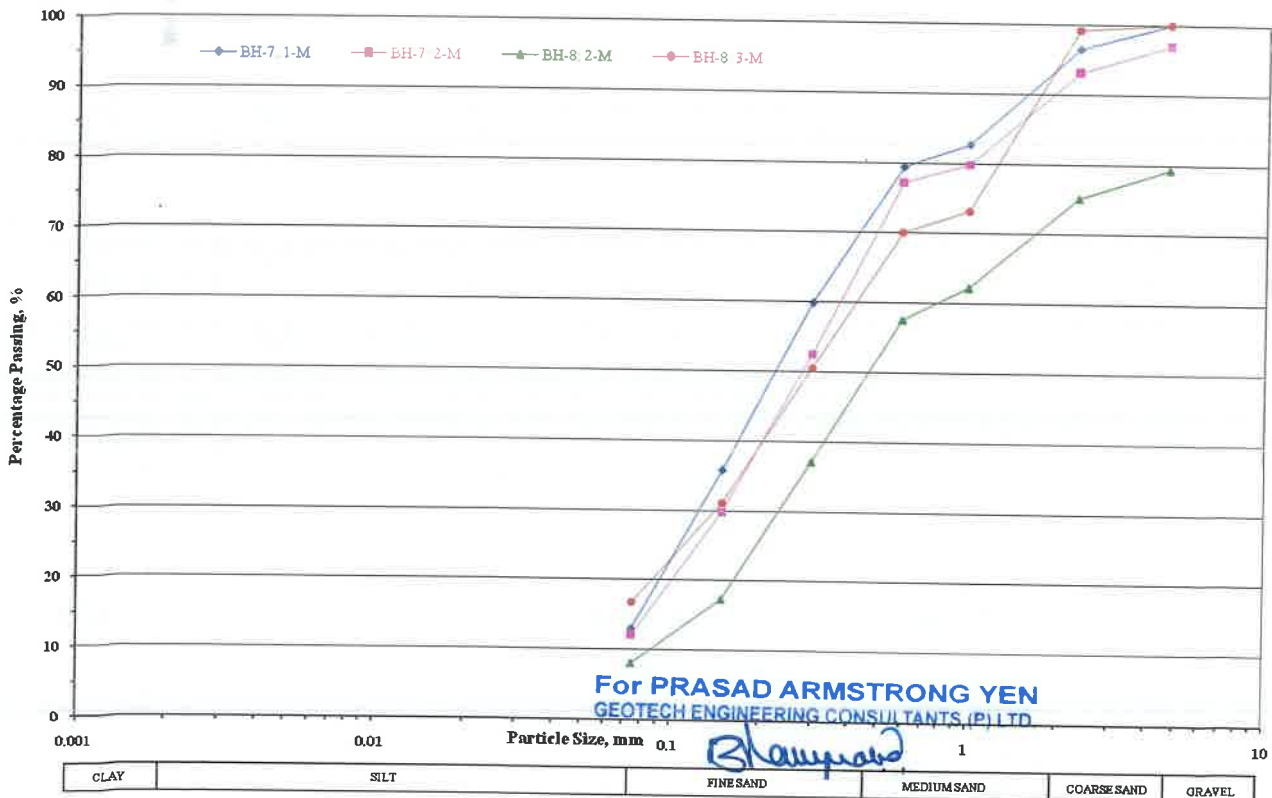Grain Size Distribution Curves
Boring 5 & 6**Grain Size Distribution Curves**
Boring 7 & 8

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD

Signature
Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 30b

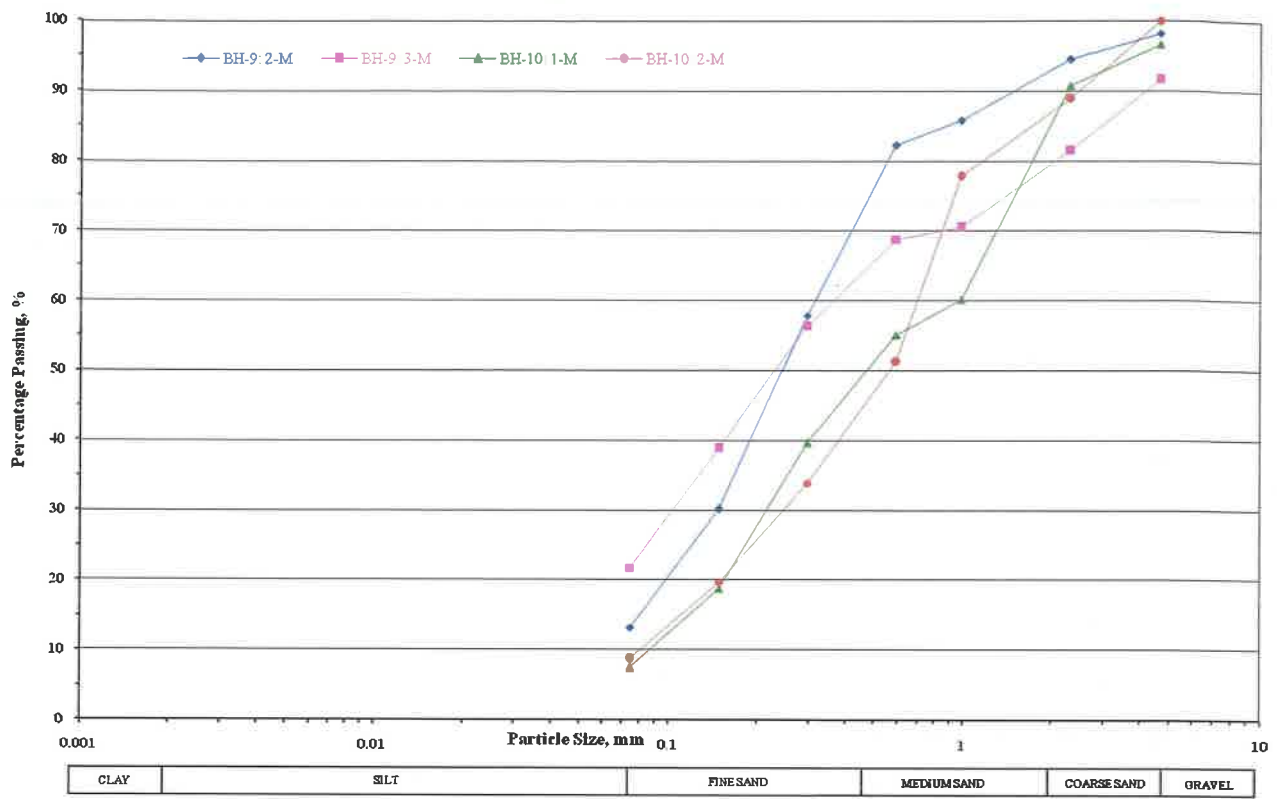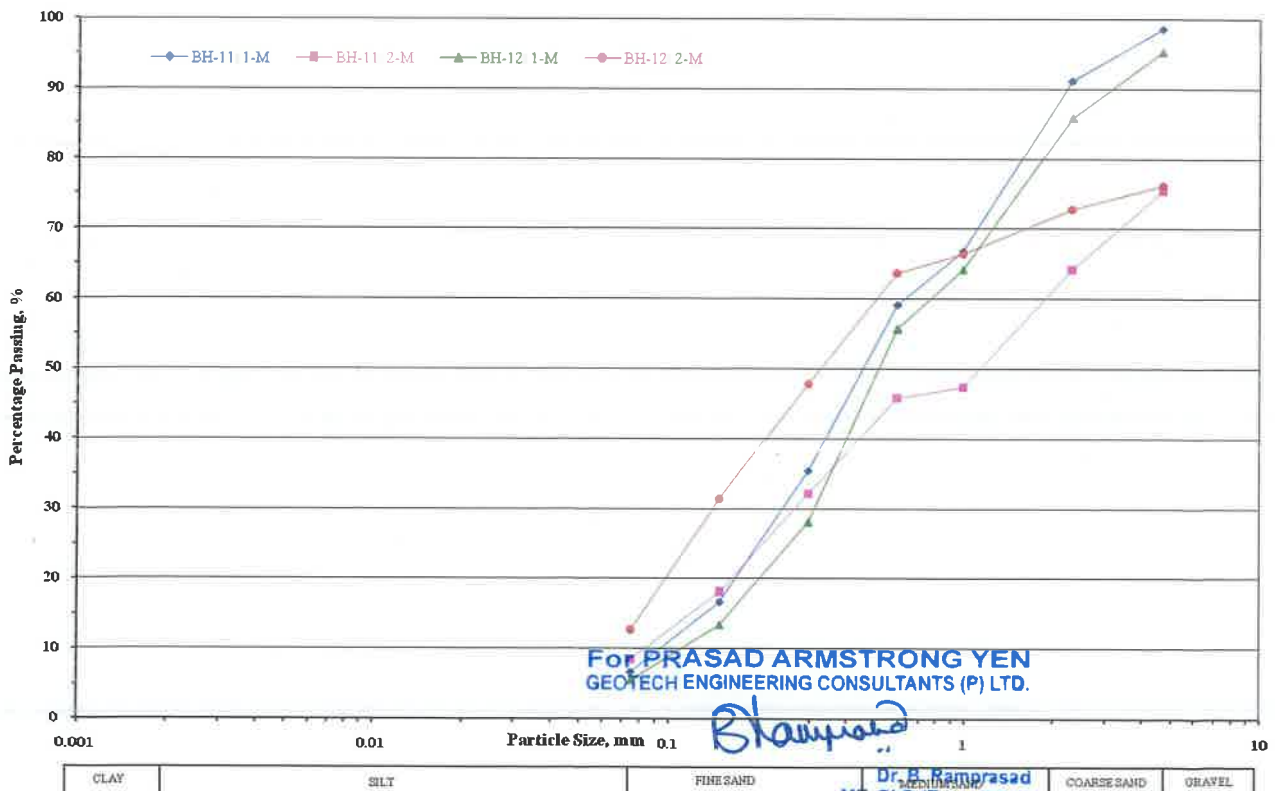
Grain Size Distribution Curves
Boring 9 & 10**Grain Size Distribution Curves**
Boring 11 & 12

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.


Signature

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

Grain Size Distribution Curves Boring 13 & 14

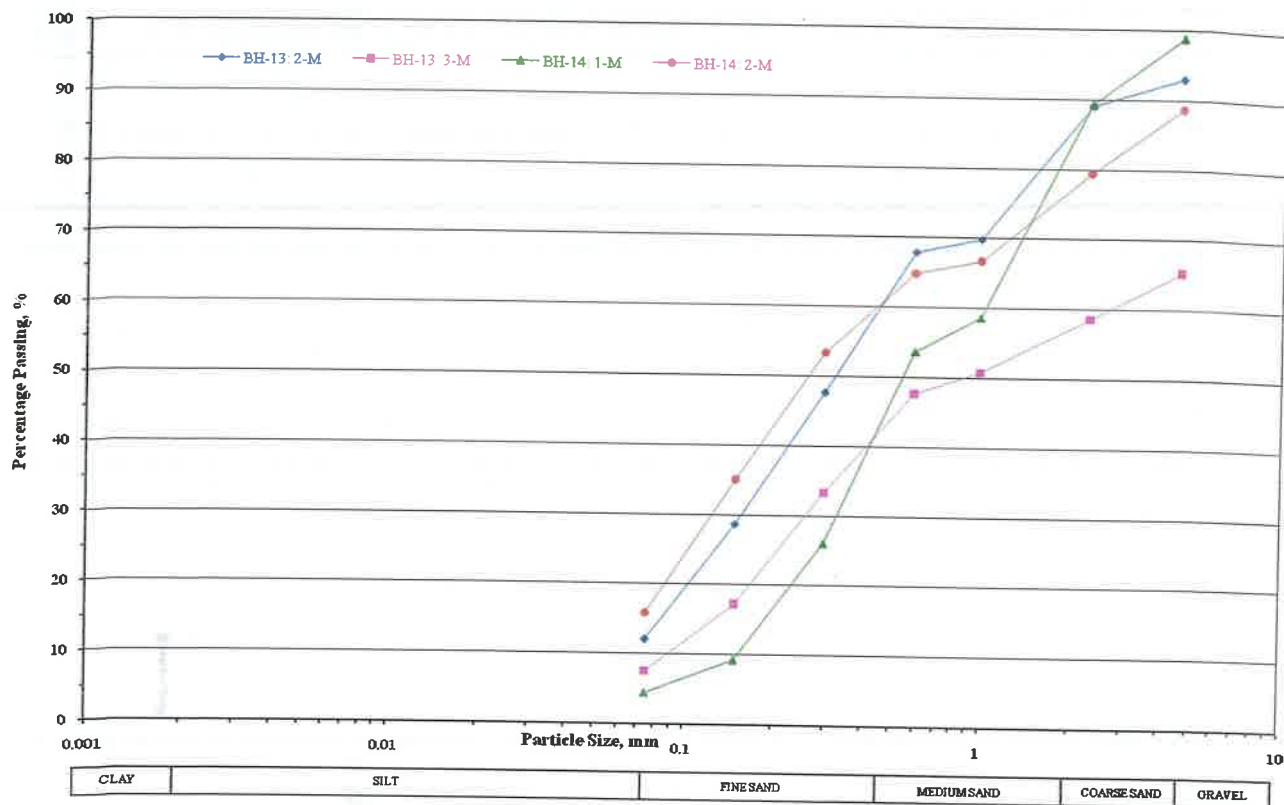

Grain Size Distribution Curves Boring 15 & 16

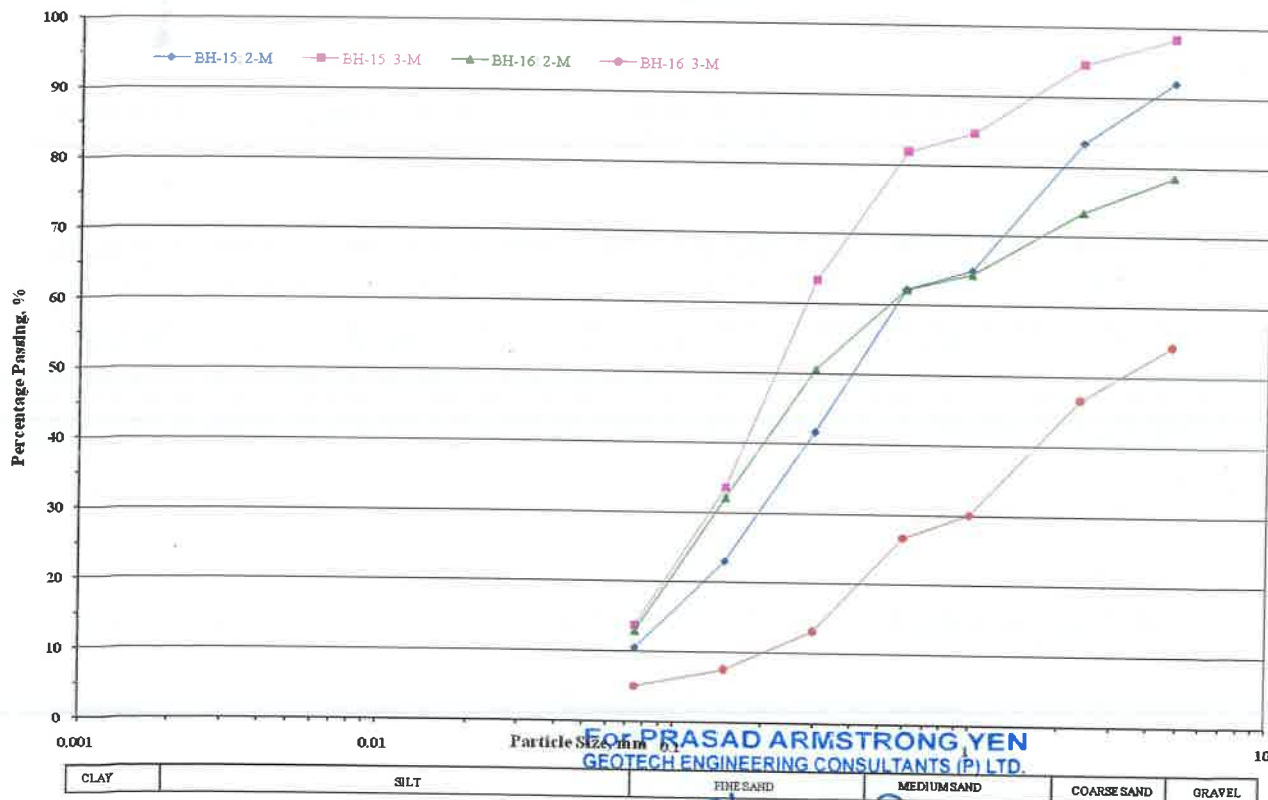

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Blampied

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 30d





Grain Size Distribution Curves
Boring 17 & 18**Grain Size Distribution Curves**
Boring 19 & 20For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.*Ramprasad*Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 30e

Grain Size Distribution Curves Boring 21 & 22



Grain Size Distribution Curves Boring 23 & 24

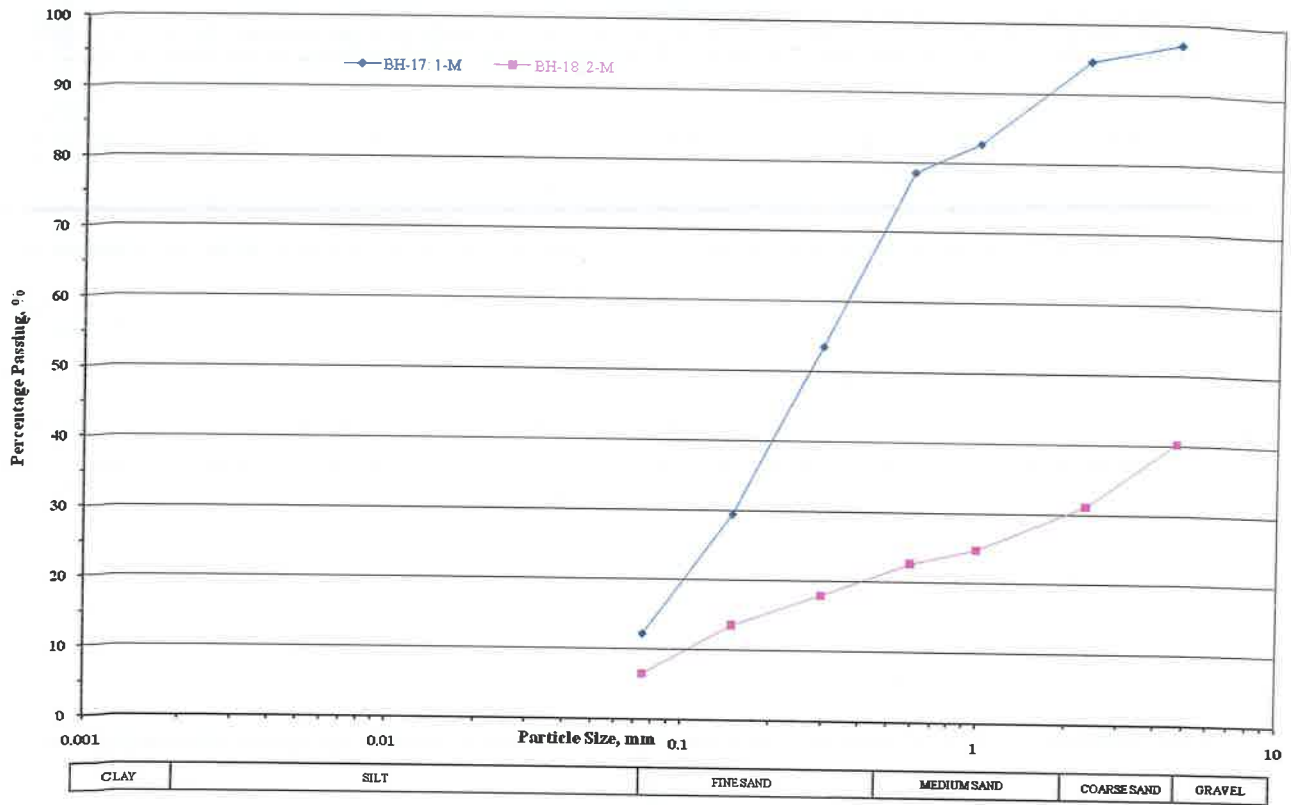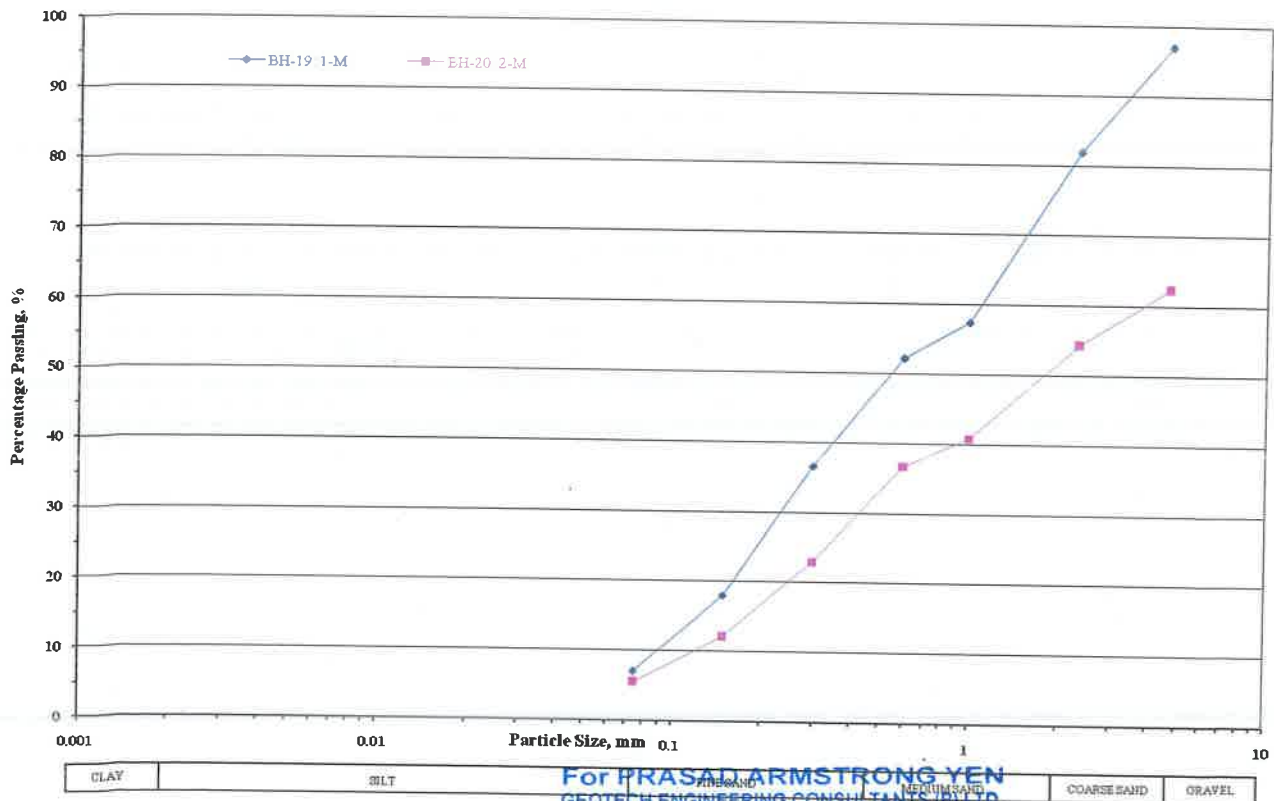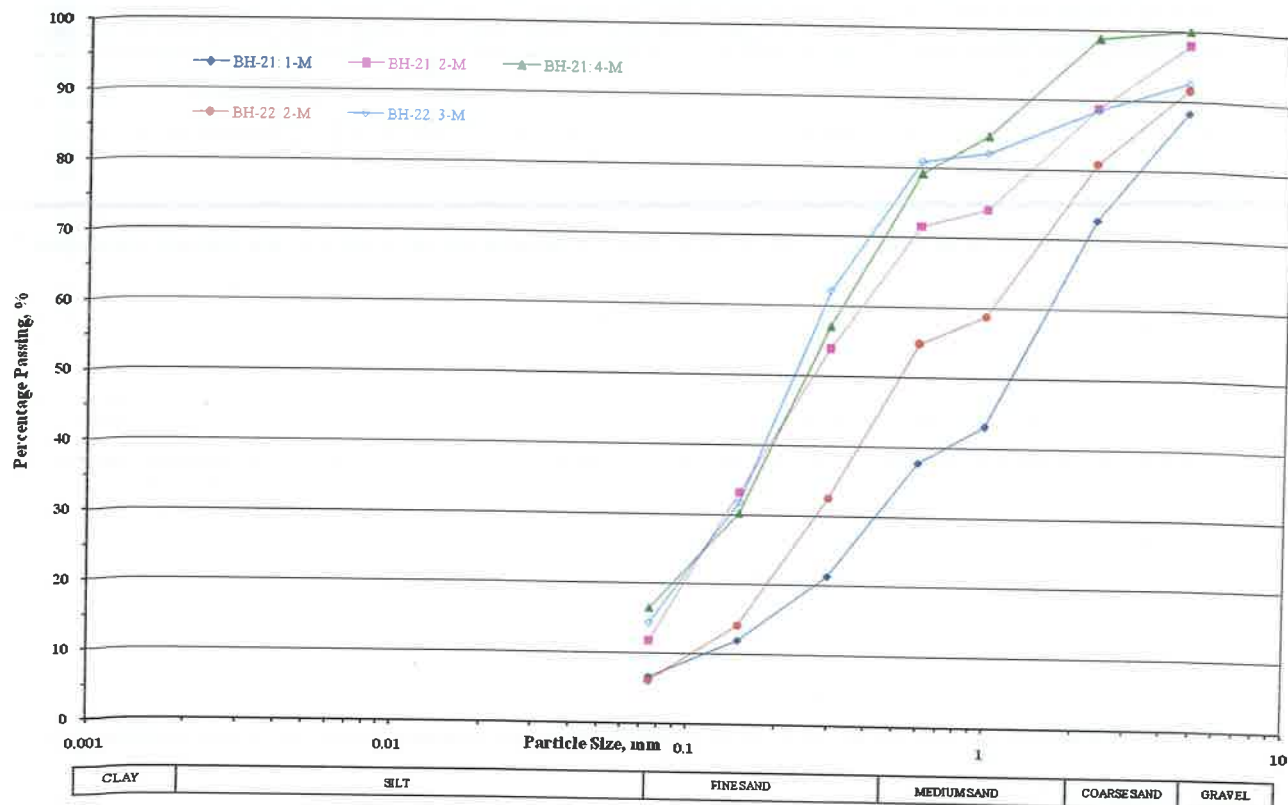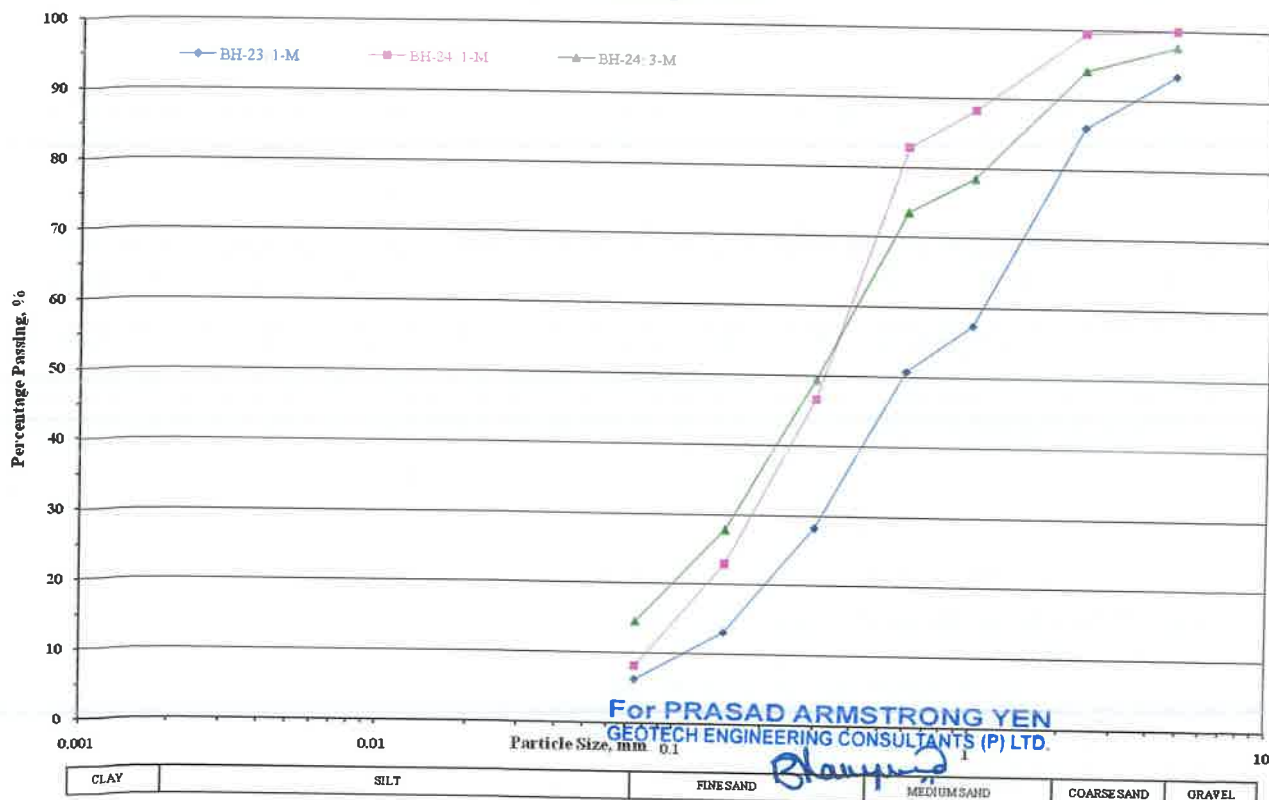


For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

PLATE 30f

Grain Size Distribution Curves
Boring 25, 26 & 27

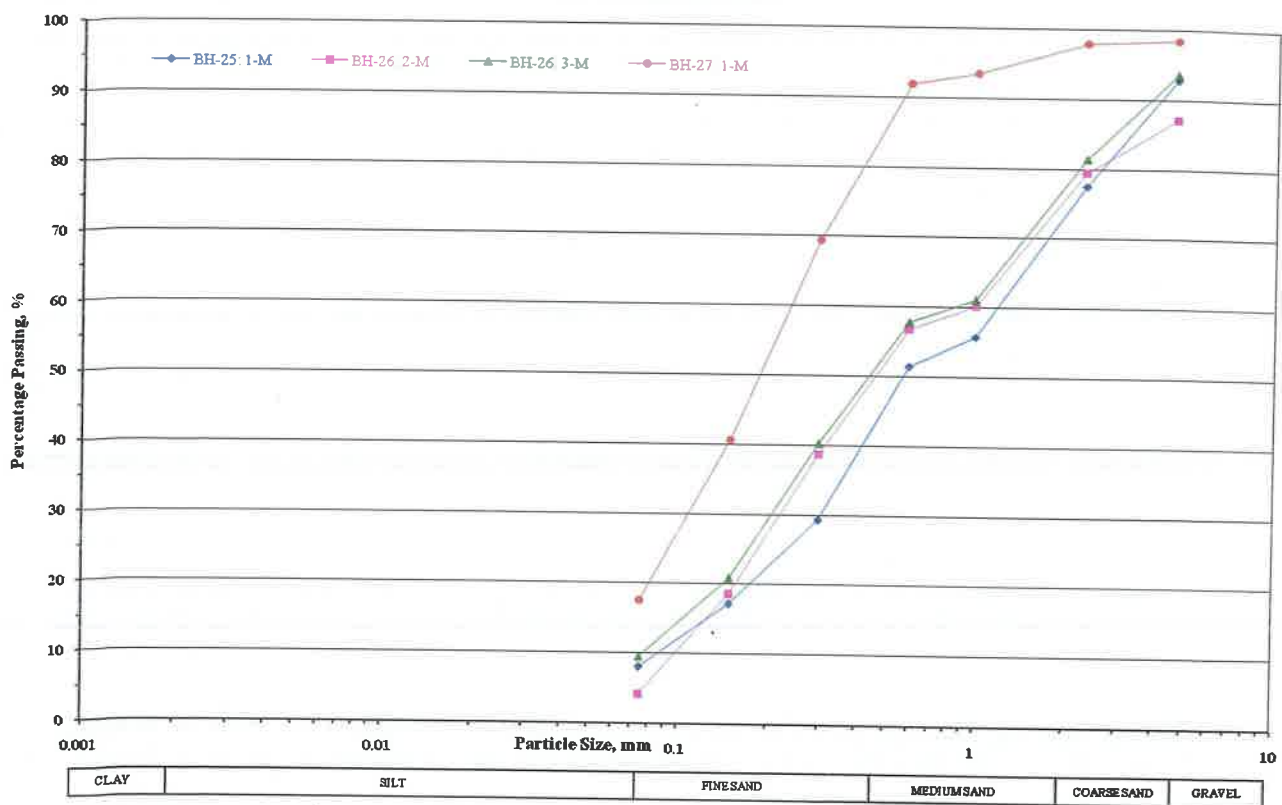

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Signature

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

SUMMARY OF WATER TEST RESULTS**PLOT'S OPEN WELL; DIAMETER = 8.25-M;****WATER LEVEL = 2.1-M; DISTANCE FROM BORING 7 ~ 27.7-M.**

S. No.	Description	Results Obtained	As per IS:456 – 2000
1	To neutralize 100 cc of water using phenolphthalein as indicator	0.6 ml	Not more than 5 ml of 0.02N NaOH
2	To neutralize 100 cc of water using methyl orange as indicator	24.0 ml	Not more than 25 ml of 0.02N H ₂ SO ₄
3	a Organic Solids, mg/liter	28	200 Max.
	b Inorganic Solids, mg/liter	780	3,000 Max.
	c Sulphates as SO ₃ , mg/liter	80	400 Max.
	d Chlorides as Cl, mg/liter	230	2,000 Max. - Plain Concrete
	e Suspended Solids, mg/liter	0	500 Max. RCC
	f pH	7.35	2,000 Max. 6 Min.

Remarks: Sample meets the requirements of all above clauses.
Hence water can be used for construction purposes as per IS 456 - 2000.

**For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.**

B. Ramprasad

**Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director**

SAMPLE CALCULATIONS FOR RECOMMENDED FOUNDATION

For the existing footings with short pile below load carrying capacity was estimated using soil properties from Boring 3 and 22. Following is a list of design assumptions:

Type of Foundation	=	Isolated Column Footing Foundation;
Foundation Depth below EGL	=	2-M below EGL;
Min. Site Filling Above EGL	=	1-M;
Foundation Depth below FGL	=	3-M (2.0 + 1.0);
Worst Case Ground Water Level	=	At EGL;
Minimum Footing Size	=	1.5- by 1.5-M;
Expected Max. Column Load	=	150 tons.

Bearing Capacity Calculations:

$$\begin{aligned} \text{Ultimate Bearing Pressure } q_{ult} &= C_u * N_c * S_c * D_c + q' (N_q - 1) * S_q * d_q + 0.5 * B * \gamma' * N_\gamma * S_\gamma * d_\gamma \\ \phi &= 33^\circ \\ C_u \text{ (Undrained Shear Strength)} &= 0 \text{ tons/M}^2 \\ N_c \text{ (Bearing Capacity Factor)} &= \text{N/A} \\ N_q \text{ (Bearing Capacity Factor)} &= 27.34 \\ N_\gamma \text{ (Bearing Capacity Factor)} &= 37.78 \\ S_c \text{ (Shape Factor)} &= 1 + 0.2 * (B/L) = 1.0 + 0.2 * (1.5/1.5) = 1.2; \\ D_c \text{ (Depth Factor)} &= 1 + 0.2 * D_f/B * \tan (45 + \phi/2) = 1.37 \\ S_q \text{ (Shape Factor)} &= 1 + 0.2 * (B/L) = 1.0 + 0.2 * (1.5/1.5) = 1.2; \\ d_q \text{ (Depth Factor)} &= 1 + 0.1 * D_f/B * \tan (45 + \phi/2) = 1.18 \\ S_\gamma \text{ (Shape Factor)} &= 1 - 0.4 * (B/L) = 1.0 - 0.4 * (1.5/1.5) = 0.60; \\ d_\gamma \text{ (Depth Factor)} &= 1 + 0.1 * D_f/B * \tan (45 + \phi/2) = 1.18 \\ q' \text{ (O B @ Footing)} &= (1.7-1) * 1.0 + (1.6-1) * 1.0 + (1.7-1) * 1.0 = 2.0 \text{ tons/M}^2 \end{aligned}$$

Note: Ground water is assumed to rise to EGL of the site.

$$\begin{aligned} q_{ult} &= 0 + 2.0 * (27.34 - 1) * 1.20 * 1.18 + 0.5 * 0.7 * 1.5 * 37.78 * 0.60 * 1.18 = 88.64 \sim 89 \text{ tons/M}^2 \\ q_{all} = q_{ult} / 2.5 &= 89 / 2.5 = 35.6 \text{ tons/M}^2 \quad \text{Use and Limit } q_{all} = 25 \text{ tons/M}^2 \end{aligned}$$

Footing Size required for 150 tons = $150/25 = 6\text{-M}^2$ or $L = B = 2.45\text{-M}$.

Therefore, 2.45- by 2.45-M footing will be required for 150 tons column load.

Settlement Calculations:

In case of isolated column footing foundation the "Zone of Influence" will extend to "2B" depth below raft, i.e., $2 * 2.45 = 4.9\text{-M}$ below footing or 6.9-M below EGL or upto hard stratum level, whichever is earlier. There will be only elastic (immediate) settlement and no consolidation (long term) settlements as profile had only weathered rock and hard rock in the zone of influence.

Elastic or Immediate Settlement:-

- 2.0- to 3.0-M = $H_1 = 1.0\text{-M}$; SPT "N" = 21; (Wea. Rock); $E_s = 3,500 \text{ tons/M}^2$
- 3.0- to 4.0-M = $H_2 = 1.0\text{-M}$; SPT "N" > 100; (Wea. Rock); $E_s = 8,500 \text{ tons/M}^2$
- 4.0- to 7.0-M = $H_3 = 3.0\text{-M}$; SPT "N" > 300; (Wea. Rock); $E_s = 10,000 \text{ tons/M}^2$

$$E_{savg} = (1.0 * 3500 + 1.0 * 8500 + 3.0 * 10000) / 5.0 = 8,400 \text{ tons/M}^2$$

$$\begin{aligned} q_0 &= 25 \text{ tons/M}^2; H/B' = 5.0/1.25 = 4.0; L/B = 2.45/2.45 = 1.0; E_p = 100,000 \text{ tons/M}^2 \\ I_f &= 0.90; I_1 = 0.403; I_2 = 0.078; I_s = 0.436; \end{aligned}$$

Dr. B. Ramprasad
GEOTECH ENGINEERING CONSULTANTS (P) LTD.

Blampy

PLATE 32a

Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

$$\Delta H_E = 4 \times 25.0 \times 1.225 \times (1 - 0.2^2) / 8400 \times 0.90 \times 0.436 \times 1000 = 5.49 \text{ mm}$$

Total Elastic Settlement $\Delta H_E = 5.49 \text{ mm}$.

Consolidation Settlement: None.

Total Consolidation Settlement $\Delta H_C = 0.00 \text{ mm}$.

Total Combined Settlement $\Delta H = \Delta H_E + \Delta H_C = 5.49 + 0.00 = 5.49 \sim 6 \text{ mm}$.

Estimated total settlement for a 2.45- by 2.45-M isolated column footing foundation at 2-M below EGL and 3-M below FGL (with at least 1-M thick site filling) was about 6 mm for a bearing pressure of 25 tons/M². The estimated total settlement was less than 60 mm – allowable limits for the total settlements for isolated column footing foundations on granular soils for framed structures with panel walls as per IS: 1904 - 2006 code.

For PRASAD ARMSTRONG YEN
GEOTECH ENGINEERING CONSULTANTS (P) LTD.



Dr. B. Ramprasad
ME, PhD (Texas A&M)
Reg. No. GTE/2024/2/0055
Managing Director

LIQUEFACTION ANALYSIS REPORT

Project title : Proposed Residential Apartments & Villa Buildings Site, Vengaivasal Village, Tambaram Tlk., Kancheepuram



Dist : TN

Project subtitle : Boring 2 Soil Profile


Input parameters and analysis data

In-situ data type: Standard Penetration Test
Analysis type: Deterministic
Analysis method: NCEER 1998
Fines correction method: Idriss & Seed


Depth to water table: 2.10 m
Earthquake magnitude M_w : 6.50
Peak ground acceleration: 0.08 g
User defined F.S.: 1.00

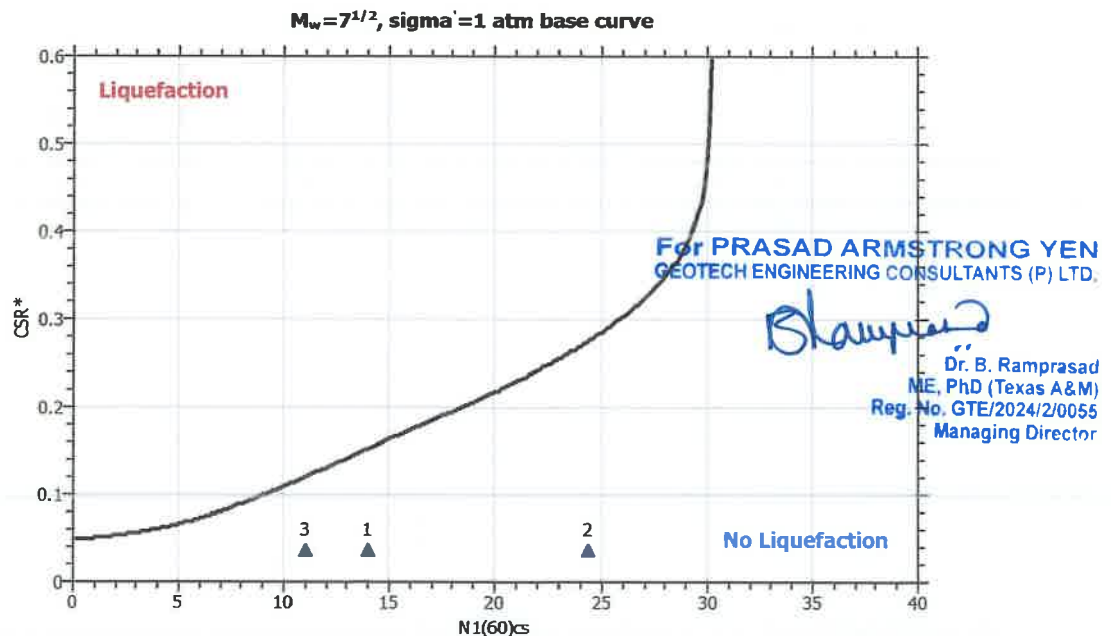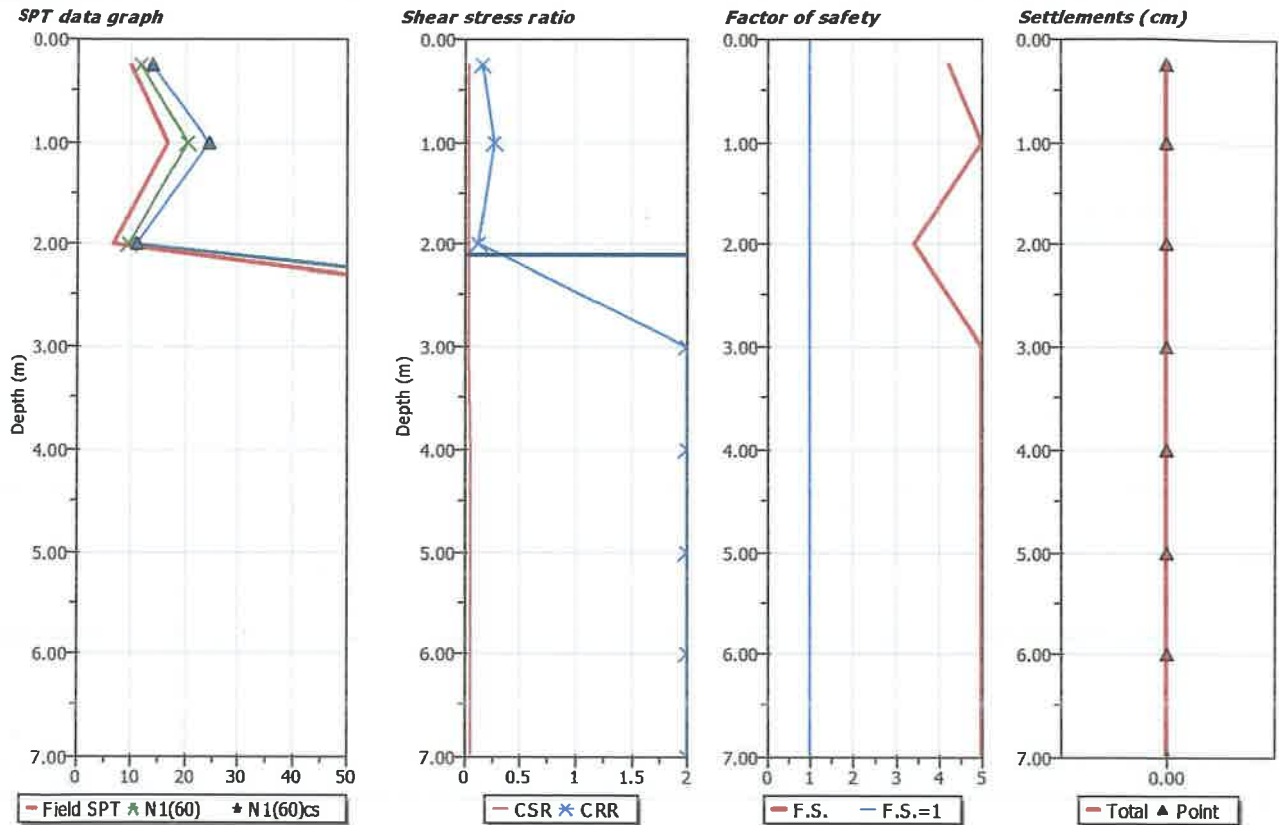

This software is licensed to : TRIAL VERSION



Geometric parameters: Gently sloping ground without free face
Total lateral displacement estimations 0.00 cm




LiqIT v. 4.6 - Soil Liquefaction Assessment Software

Blank:

PLATE 33b

PRASAD ARMSTRONG YEN G E C (P) LTD.
821 (Old # 439/4) Poonamallee High Road

Arumbakkam, Chennai 600 106.
phone: 044 - 2363 7146; e-mail: paygec@gmail.com

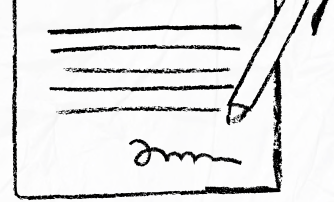

our services doesn't just end there



Buying & Selling Services

Property Buying Assistance, Property Selling Support, Market Price Analysis, Owner Outreach and Negotiation.



Legal & Documentation Services

Certified EC, Patta, legal opinions, property verification, due diligence, litigation solutions, and legal heir certificates.



Property Development & Approvals

Building plan approvals, construction, layout and sub-division approvals, zone conversion, and occupancy certification.




NRI & Investment Services

Escrow Services, Rentals, Litigation Solutions, Property Valuation and Property Management



Compliance & Special Services

Demolition, Vaasthu checks, regularization of unauthorized buildings, and office space solutions.

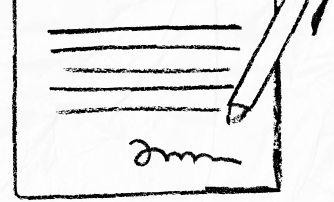

 **empowering your real estate decisions
with smart tools**



Property Valuation & Cost Estimation

Guideline Value, Apartment Composite Value, Stamp Duty & Registration Fees Calculator, Building Value Calculator, Capital Gains Calculator, Area Unit Converter, Length Unit Converter



Ownership, Compliance & Legal Verification

Encumbrance Certificate (EC) Search, Find Your SRO, Temple Property Check, WAQF Property Check, View Patta/Chitta, View FMB, Patta Analyzer, EC Analyzer



Zoning & Land Use Analysis

Land Use Zone Finder, CRZ Zone Check, Aquifer Zone Check, CBA Check, EWS Check, Road Width Check, Proposed Road Widening Check, FSI Calculator



Property Documentation & Workflow Tools

Forms & Templates, Document Generator, Document Translation, Dictionary



Vastu & Property Management Tools

Home Vastu Shastra, Plot Vastu Shastra, Property Management



We're honored to be part of your
real estate journey

3/350/2 Mettukuppam,
OMR Thoraipakkam,
Chennai, India

hello@verified.realestate
[+91 9996 12 9996](tel:+919996129996)
www.verified.realestate